



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার  
শ্রম ও কর্মসংস্থান মন্ত্রণালয়  
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	কালার স্টীচ লি:
ঠিকানা	119, Ashkona Medical Road,
কারখানার কোড	DHK132
কালার কোড	

মূল্যায়নের ধরণ: **বৈদ্যুতিক মূল্যায়ন**

পর্যবেক্ষণের তারিখ: **০২-০৮-২০২৩**

১. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Transformer room walls less than 4hr fire resistance □ Door having fire resistance rating less than 2hr □ No separating wall between Switchgears and Transformer □ Poor illumination in transformer room □ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

#### ১.১. কার্যক্রম

কার্যক্রম	□ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Transformer room. □ Provide firefighting equipment as required by the Guidelines.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অণ্টার্থিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	চলগাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Transformer room walls are not less than 4hr fire resistance. No separating wall between Switchgears and Transformer. Inadequate cross ventilation for the transformer room. 08-10-2020: Transformer room walls are less than 4hr fire resistance. No separating wall between Switchgears and Transformer. Inadequate cross ventilation for the transformer room. 26-01-2021 on visit day Transformer room walls are not less than 4hr fire resistance. No separating wall between Switchgears and Transformer. Inadequate cross ventilation for the transformer room. 10-06-2021: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling were found but no approved fire rated self-closing swing door installed for the Transformer room. 2. Fire-fighting equipment were observed in substation room. 07-08-2022 Visit Observation: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling were found but no approved fire rated self-closing swing door installed for the transformer room. 2. Fire-fighting equipment were observed in substation room. 02-04-2023: Same as previous visit.
সংযুক্তিসমূহ (২)	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>

#### ২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Transformer room walls less than 4hr fire resistance □ Door having fire resistance rating less than 2hr □ No separating wall between Switchgears and Transformer □ Poor illumination in transformer room □ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

## ২.১. কার্যক্রম

কার্যক্রম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Transformer room. □ Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অণ্ডাখিকার	৬ মাস
চূড়ান্ত সময়সীমা	০৭-১২-২০১৭
সংশ্লাধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হবাণি
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Not Install appropriate detectors to Transformer room. 08-10-2020: Not Install appropriate detectors to Transformer room. 26-01-2021 on visit day Not Install appropriate detectors to Transformer room. 10-06-2021: 1. Fire rated enclosure from floor to ceiling were not adequate and an approved fire rated self-closing swing door for the Transformer room were not installed. 2. No appropriate detector observed for the substation room. 07-08-2022 Visit Observation: 1. Fire rated enclosure from floor to ceiling were not adequate and an approved fire rated self-closing swing door for the Transformer room were not installed. 2. No appropriate detector observed for the substation room. 02-04-2023: Same as previous visit.
সংযুক্তসমূহ ( 8 )	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

## ৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Transformer room walls less than 4hr fire resistance □ Door having fire resistance rating less than 2hr □ No separating wall between Switchgears and Transformer □ Poor illumination in transformer room □ Inadequate cross ventilation for the transformer room
ক্যাপ আইটেম ক্যাটাগরি	

### ৩.১. কার্যক্রম

কার্যক্রম	Ensure illumination and cross ventilation to Transformer
মুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. Complete within timeline. 25-06-2020 visit Observation: Not Install illumination and cross ventilation to Transformer 08-10-2020: No illumination and cross ventilation installed to Transformer. 26-01-2021: On visit day No illumination & cross ventilation installed to Transformer. 10-06-2021: Adequate illumination and cross ventilation observed for transformer room. 07-08-2022 Visit Observation: Adequate illumination and cross ventilation observed for transformer room. 02-04-2023: Same as previous visit.
সংযুক্তসমূহ ( 8 )	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>

### ৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Inadequate ventilation of the generator room □ The generator room is not properly segregated from the rest of the occupancy □ One point frame earthing of generator instead of two □ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

#### ৪.১. কার্যক্রম

কার্যক্রম	□ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অণ্ডাখিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশ্লাধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলচ্চাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 08-10-2020: Exhaust fan is found. Generator room have adequate cross ventilation. Body earthing of generator are found at two points. The generator room is segregated from the rest of the occupancy. They are providing cable trench at generator room. 26-01-2021: On visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy . Found two point frame earthing of generator. 10-06-2021: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was found but approved fire rated self-closing swing door for the generator room was not installed. 2. Inadequate ventilation of the generator room was observed. 07-08-2022 Visit Observation: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was found but approved fire rated self-closing swing door for the generator room was not installed. 2. Inadequate ventilation of the generator room was observed. 02-04-2023: Same as previous visit.
সংযুক্তিসমূহ (২)	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>

#### ৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	॥ Inadequate ventilation of the generator room ॥ The generator room is not properly segregated from the rest of the occupancy ॥ One point frame earthing of generator instead of two ॥ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

#### ৫.১. কার্যক্রম

কার্যক্রম	॥ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room .
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	৬ গ্যাস
চূড়ান্ত সময়সীমা	০৭-১২-২০২১
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবলি
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: 08-10-2020: No fire door was found for generator room. 26-01-2021 on visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy . Found two point frame earthing of generator. 10-06-2021: 1. The generator room is not properly segregated with fire rated wall and self swing fire rated door from the rest of the occupancy. 2. Inadequate ventilation of the generator room. 07-08-2022 Visit Observation: 1. The generator room is not properly segregated with fire rated wall and self swing fire rated door from the rest of the occupancy 2. Inadequate ventilation of the generator room. 02-04-2023: Same as previous visit.
সংযুক্তিমূহ ( ৮ )	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

#### ৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	॥ Inadequate ventilation of the generator room ॥ The generator room is not properly segregated from the rest of the occupancy ॥ One point frame earthing of generator instead of two ॥ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

#### ৬.১. কার্যক্রম

কার্যক্রম	॥ Provide cover on the cable trench ॥ Ensure double earthing of generator frame.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অধার্থিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	চলচাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: One point earthing of generator frame. Not cover on the cable trench. 08-10-2020: Body earthing of generator are found at two points. They are providing cable trench at generator room. 26-01-2021: On visit day Inadequate ventilation of the generator room. The generator room is not properly segregated from the rest of the occupancy .Found two point frame earthing of generator. 26-01-2021 on visit day Body earthing of generator are found at two points. 10-06-2021: 1. Cable trenches were not covered properly. 2. Double earthing observed at generator body frame. 07-08-2022 Visit Observation: 1. Cable trench were not covered properly. 2. Double earthing were observed at generator body frame. 02-04-2023: Same as previous visit.
সংযুক্তিমূহ ( ৮ )	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

#### ৭. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Ventilation and illumination of substation is poor □ Separating wall not extended up to the ceiling □ No clear identification mark on distribution panel □ No instruction for first aid to electrical shock and artificial respiration □ Non-conductor mat not provided
ক্যাপ আইটেম ক্যাটাগরি	

#### ৭.১. কার্যক্রম

কার্যক্রম	□ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Substation room. □ Provide clear identification mark on distribution panel.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have already started work on this issue and supposed to be complete within timeline
অধ্যাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১১-০৭-২০১৭
সংশ্লাধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলচ্চাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 11-Jul-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: No clear identification mark on distribution panel. Non-conductor mat not provided 08-10-2020: Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. Clear identification mark on distribution panel was found. No instruction for first aid to electrical shock and artificial respiration. Conductor mat are provided in front of DB boards. 26-01-2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. Clear identification mark on distribution panel was found. No instruction for first aid to electrical shock and artificial respiration. Conductor mat are provided in front of DB boards. 10-06-2021: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling was produced and fire rated self-closing swing door for the Substation room was not approved yet. 2. Clear identification mark observed on distribution boards. 07-08-2022 Visit Observation: 1. Design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling were produced and fire rated self-closing swing door for the Substation room were not approved yet. 2. Clear identification mark were observed on distribution boards. 02-04-2023: Same as previous visit.

#### সংযুক্তিমূহ ( ৮ )



#### ৮. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	☒ Ventilation and illumination of substation is poor ☒ Separating wall not extended up to the ceiling ☒ No clear identification mark on distribution panel ☒ No instruction for first aid to electrical shock and artificial respiration ☒ Non-conductor mat not provided
ক্যাপ আইটেম ক্যাটাগরি	

#### ৮.১. কার্যক্রম

কার্যক্রম	☒ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Substation room. ☒ Install appropriate detectors
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	৬ গ্যাস
চূড়ান্ত সময়সীমা	০৭-১২-২০২৭
সংশোধিত সময়সীমা	০৬-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবলি
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Not Install appropriate detectors to Substation room. 08-10-2020: Did not install appropriate detectors to Substation room. 26-01-2021: On visit day Did not install appropriate detectors to Substation room. 10-06-2021: 1. Substation room was not segregated from the rest of the occupancy with fire rated wall and self swing fire rated door. 2. Appropriate detector was not found for the substation room. 07-08-2022 Visit Observation: 1. Substation room were not segregated from the rest of the occupancy with fire rated wall and self swing fire rated door. 2. Appropriate detector were not found for the substation room. 02-04-2023: Same as previous visit.

#### সংযুক্তিমূহ (২)



#### ৯. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Ventilation and illumination of substation is poor □ Separating wall not extended up to the ceiling □ No clear identification mark on distribution panel □ No instruction for first aid to electrical shock and artificial respiration □ Non-conductor mat not provided
ক্যাপ আইটেম ক্যাটাগরি	

#### ৯.১. কার্যক্রম

কার্যক্রম	□ Ensure ventilation and illumination to substation □ Provide instructions for first aid and artificial respiration from exposure to electrical shock. □ Provide rubber mat in front of the panel
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অধ্যাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	চলচ্চাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Non-conductor mat not provided. 08-10-2020: Provided rubber mat in front of the panel. 26-01-2021 on visit day rubber mats are kept in front of distribution boards. 10-06-2021: 1. Adequate illumination and ventilation observed for substation room. 2. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 3. Insulated rubber mat was not provided in front of some panels for e.g. HT panel. 07-08-2022 Visit Observation: 1. Adequate illumination and ventilation observed for substation room. 2. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 3. Insulated rubber mat was not provided in front of some panels for e.g. HT panel. 02-04-2023: Same as previous visit.
সংযুক্তিমূহ ( ৮ )	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

#### ১০. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Cable ends not properly soldered or crimped □ Visible burn marks □ Connection without lug □ Undressed messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB/SDB/SB or MCB installed on the wooden board □ Live parts of machine or equipment exposed
কাপ আইটেম ক্যাটাগরি	

#### ১০.১. কার্যক্রম

কার্যক্রম	□ Repair broken/loose MCCB/MCB box. □ Provide duplicate earth leads. □ Provide earthing to body & door. □ Provide earth bar/neutral bar □ Identify cause of burning inside distribution box and take remedial measures □ Provide clear identification mark on distribution board. □ Install MDB/SDB/SB or MCB on metal board.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতিৰ অবস্থা	চলগাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: No instruction for first aid to electrical shock . Visible burn marks. Connection without lug .Body & door not earthed .No clear identification mark on distribution board .Live parts of machine or equipment exposed. 08-10-2020 No instruction for first aid to electrical shock. Cable ends are soldered. No visible burn marks were found. Connections are with lugs. No undressed messy wire was found inside the panel boards. Body & door are not earthed. Clear identification marks are found on distribution board. No MDB/SDB/SB or MCB installed on the wooden board. No live parts of machine or equipment are exposed. 26-01-2021 on visit day No instruction for first aid to electrical shock .Cable ends not properly soldered or crimped .Visible burn marks. Connection with lug. Body & door not earthed. No clear identification mark on distribution board. 10-06-2021: 1. No broken or loose MCCB/MCB box observed. 2. Duplicate earth leads were not installed. 3. Some distribution boards and its door were not grounded with the earthing system. 4. Earth bar/neutral bar was provided in every distribution boards. 5. No visible burn marks observed in any distribution boards. 6. Clear identification mark observed for the distribution boards. 7. MDB/SDB/SB or MCB were installed on non-combustible material. 07-08-2022 Visit Observation: 1. No broken or loose MCCB/MCB box were observed. 2. Duplicate earth leads were not installed. 3. Some distribution boards and its door were not grounded with the earthing system. 4. Earth bar/neutral bar was provided in every distribution boards. 5. No visible burn marks observed in any distribution boards. 6. Clear identification mark observed for the distribution boards. 7. MDB/SDB/SB or MCB were installed on non-combustible material. 02-04-2023: Same as previous visit.

#### সংযুক্তিমূহ ( ৮ )



পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Cable ends not properly soldered or crimped □ Visible burn marks □ Connection without lug □ Undressed messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB/SDB/SB or MCB installed on the wooden board □ Live parts of machine or equipment exposed
কাপ আইটেম ক্যাটাগরি	

#### ১১.১. কার্যক্রম

কার্যক্রম	□ Provide instructions for first aid from exposure to electrical shock □ Ensure well-dressed cabling with lugs □ Encase live machine and/or equipment parts
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অধ্যাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	চলগাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has no taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Undressed messy wire inside. 08-10-2020: No instruction for first aid to electrical shock. Connections are with lugs and No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 10-06-2021: 1. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 2. Cables were well dressed with proper sized lugs. 3. All electrical equipment have proper mechanical guards. 07-08-2022 Visit Observation: 1. Instruction board for first aid and artificial respiration were not observed in the substation room and generator room but was found near floor distribution boards. 2. Cables were well dressed with proper sized lugs. 3. All electrical equipment have proper mechanical guards. 02-04-2023: Same as previous visit.

#### সংযুক্তিমূহুর ( 8 )



#### ১২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Electric cables do not pass through electrical service shaft or insulated conduits Connections without lug Undressed messy wiring/cables Cable ends not properly soldered or crimped
ক্যাপ আইটেম ক্যাটাগরি	

#### ১২.১. কার্যক্রম

কার্যক্রম	Provide electrical service shaft or insulated conduits Ensure secured connections with lug Replace undressed messy wiring/cables Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অণ্ডাখিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৯-০৭-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অণ্ডাখিকার অবস্থা	সংশোধিত
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 19-Jul-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: Electric cables do not pass through electrical service shaft or insulated conduits. Connections without lug .Cable ends not properly soldered or crimped. 08-10-2020: Cable ends are soldered. Connections are with lugs. No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 26-01-2021: On visit day Cable ends are soldered. Connections are with lugs. No undressed messy wire was found inside the panel boards. No live parts of machine or equipment are exposed. 10-06-2021: 1. Electrical cables rises from floor to ceiling through insulated conduits. 2. Cables were secured with proper sized lugs at the termination points of MCCB/MCB. 3. Cables were dressed properly inside the distribution boards. 4. Cable ends were soldered properly. 07-08-2022 Visit Observation: 1. Electrical cables rises from floor to ceiling through insulated conduits. 2. Cables were secured with proper sized lugs at the termination points of MCCB/MCB. 3. Cables were dressed properly inside the distribution boards. 4. Cable ends were soldered properly. 02-04-2023: Same as previous visit.
সংযুক্তিমূহ ( 8 )	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>

#### ১৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Lightning protection system not available
কাপ আইটেম ক্যাটাগরি	

### ১৩.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but we will take action and complete within this timeline.
অঞ্চলিকার	৬ মাস
চূড়ান্ত সময়সীমা	০৭-১২-২০২১
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অঞ্চলিক অবস্থা	চলচ্চাল
মন্তব্য	Previous Timeline: N/A. had no CAP Report Final Timeline: 7-Dec-17. Factory has not taken any action yet but they will have agreed to complete within timeline. 25-06-2020 visit Observation: They are not found Lightning protection system. 08-10-2020: Approved LPS design drawing is found on site. They are willing to work as soon as possible. 26-01-2021 on visit day Approved LPS design drawing is found on site. the factory roof top Lightning protection system is not installed. 10-06-2021: Lightning protection design was found available in the factory but did not install yet. 07-08-2022 Visit Observation: LPS drawing already approved from DIFE but factory not yet installed LPS system. 02-04-2023: Same as previous visit.

### সংযুক্তিসমূহ (২)

