

## গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

# ক্যাপ পর্ববেষ্ফণের তথ্য

কারখানার নাম	বেষ্ট ষ্টাইল কম্পোজিট লিমিটেড, ইউনিট-০১
ঠিকানা	Azad plaza bhaban, Israfil sarkar road, Fatullah, Narayanganj
কারখানার কোড	NRY043
কালার কোড	

<del>গ্যার(গর বর</del> ণ	: কঠামোগত মূল্যানন	পর্ববেষ্ফণের তারিখ:
পর্ববেষ্ণণ		
পরিদর্শন পর্ববেষ্ফণ	ressed columns	
ক্যাপ আইটেম ক্যাটাগরি		
১.১. কাৰ্যক্ৰ	4	
কাৰ্যক্ৰম	Factory Engineer to review design, loads and colabove.	umns stresses in area identified
সুপারিশের তথ্যসূত্র		
কার্থানার কার্যক্রম	Not taken any action yet but the management is	willing to do it before timeline
অগ্রাধিকার	৬ সপ্তাহ	
চুডান্ড সময়সীমা	05-09-5079	
সংশোধিত সময়সীমা	07-07-7940	
অগ্রগতির অবস্থা	চলমাল	
মন্তব্য	On 12–11–2020 – As built architectural drawing, speen found on site, DEA report has been prepare approval (Not found at site), only submission le 02–02–2021: A submission letter of DEA report obut no drawings, drawing, load plan and DEA report of 17–08–2021: A submission letter of DEA report obut no drawings, drawing, load plan and DEA report no drawings.	ed and submitted to DIFE for tter of that is available. CVV2: of RCC building have been found port are available on site. CVV3: f RCC building have been found

## ২. পর্ববেষ্ণণ

<del></del>	
জাইটেম ক্যাটার্গরি	

## ২.১. কাৰ্যক্ৰম

কাৰ্শক্ৰম	Verify in–situ concrete stresses either by 100mm dia. cores or existing cylinder strength data for the identified columns or 100mm dia. cores from 4 columns.
সুপারিশের ভখ্যসূত্র	
	Not taken any action yet but the management is willing to do it before timeline
<u>অগ্রা</u> খিকার	৬ সম্ভাহ
চুডান্ড সমশ্রসীমা	02-02-5028
সংশোধিত সমশ্রসীমা	07-07-7940
অগ্রগতির অবস্থা	চলমান
মন্তব্য	On 12-11-2020-Evidence of core cutting has been found. But no test report has been found during inspection day. CVV2: 02-02-2021: Core cutting has been observed but no test report is available on site. CVV3: 19-08-2021: Core cutting has been observed but no test report is available on site:

## ৩. পর্ববেষ্ণণ

পরিদর্শন পর্শবেষ্কণ	Stressed columns
ক্যাপ আইটেম	
ক্যাটাগরি	

#### ৩ ১ কার্যক্রম

৩.১. কাশক্র	o.১. কা <del>ৰ্</del> জ্ম	
কাৰ্যক্ৰম	Produce and actively manage a loading plan for all floor plates within the factory giving consideration to floor capacity and column capacity	
সুপারিশের তখ্যসূত্র		
কার্থানার কার্বক্রম	Not taken any action yet but the management is willing to do it before timeline	
অগ্রাধিকার	৬ মাস	
চুডান্ড সমশ্বসীমা	88-07-5074	
সংশোধিত সময়সীমা	07-07-7940	
অগ্রগতির অবস্থা	চলমাল	
ম্ভব্য	On 12–11–2020– As built architectural drawing, structural drawing, load plan has been found on site, DEA report has been prepared and submitted to DIFE for approval (Not found at site), only submission letter of that is available. CVV3: 19–08–2021: A submission letter of DEA report of RCC building have been found but no drawings, drawing, load plan and DEA report are available on site. CVV3: 19–08–2021: A submission letter of DEA report of RCC building have been found but no drawings, drawing, load plan and DEA report are available on site.	

৪. পর্ববে	ষ্ট্ৰণ	
পিরিদ	ह।	
<del>  ` ` ` `</del>	ণি Unapproved vertical extension and incomplete structural drawing	
ক্যাপ   আইটো	ম ম	
का <u>्र</u> ोही	वि	

.১. কাৰ্যক্ৰ	<u>ነ</u>
কাৰ্শক্ৰম	Vertical extension needs to be checked by building engineer and as built architectural and engineering drawing need to be prepared for the entire building and submitted for approval additional floor by appropriate authority. As part of this process building engineer will be required to make a number of checks on the structural design.
সুপারিশের তখ্যসূত্র	
কার্নথানার কার্বক্রম	Not taken any action yet but the management is willing to do it before timeline
<u>অগ্রা</u> ধিকার	৬ মাস
চুডান্ড সময়সীমা	28-02-2029
সংশোধিত সময়সীমা	02-07-7940
অগ্রগতির অবস্থা	শুৰু হয়নি
মন্তব্য	On 12–11–2020 – Unapprove vertical extension non–engineering shed has been found. CVV2:02–02–2021: Unapprove vertical extension non–engineering shed ha been found. No design documents and stability check of steel shed have been found on site. CVV3:19–08–2021: Unapprove vertical extension non–engineering shed has been found. No design documents and stability check of steel shed have been found on site.