



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সমৃদ্ধ শ্রমিক, শোভন কর্মপরিবেশ;
গড়ে তুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	মেসার্স গুড গাইস লিঃ		
ঠিকানা	J-L-12, Dag # 505, 554, Bailjury, Turag, Uttara, Dhaka		
কারখানার কোড	DHK234		
কালার কোড			

মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন	পর্যবেক্ষণের তারিখ: ০৩-০৪-২০২৩
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	<p>□ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ No detector in generator room □ One point frame earthing of generator instead of two □ No cover on the cable trench □ Lint/dirt in generator room</p>
ক্যাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	<p>□ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. □ Provide firefighting equipment as required by the Guidelines.</p>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০১-০৯-২০১৬
সংশোধিত সময়সীমা	০১-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>11-02-2020 Visit Observation : Not Started anything yet on this issue. 01-02-2021 Visit Observation : The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 07-06-2021: The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 31-08-2021: The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 21-08-2022 : 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. 2. Firefighting equipment is present in the generator room but not appropriate. 3. Combustible materials inside generator room. 4. No detector in generator room. 5. One point frame earthing of generator instead of two. 6. No cover on the cable trench. 7. Lint/dirt in generator room. 03-04-2023 : Same as before.</p>

সংযুক্তিসমূহ (১২)



২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated No firefighting equipment is present in the generator room Combustible materials inside generator room No detector in generator room One point frame earthing of generator instead of two No cover on the cable trench Lint/dirt in generator room
ক্যাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	২১-০১-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation : The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 07-06-2021:The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 31-08-2021:The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 21-08-2022 : 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. 2. Firefighting equipment is present in the generator room. 3. Combustible materials inside generator room. 4. No detector in generator room. 5. One point frame earthing of generator instead of two. 6. No cover on the cable trench. 7. Lint/dirt in generator room. 03-04-2023 : Same as before.</p>

৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ No detector in generator room □ One point frame earthing of generator instead of two □ No cover on the cable trench □ Lint/dirt in generator room
ক্যাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> □ Remove Combustible materials from generator room and keep it clean. □ Frame earthing must be two □ Provide cover on the cable trench
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	০১-০৯-২০১৬
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation : The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 07-06-2021:The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 31-08-2021:The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. No firefighting equipment is present in the generator room. 21-08-2022 : 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated. 2. Firefighting equipment is present in the generator room. 3. Combustible materials inside generator room. 4. No detector in generator room. 5. One point frame earthing of generator instead of two. 6. No cover on the cable trench. 7. Lint/dirt in generator room. 03-04-2023 : Same as before.</p>

৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Panel door damaged/not present <input type="checkbox"/> No instruction for first aid to electrical shock <input type="checkbox"/> <input type="checkbox"/> Connections without lug <input type="checkbox"/> Undressed messy wire inside <input type="checkbox"/> Body & door not earthed <input type="checkbox"/> No SLD/clear identification mark for distribution board <input type="checkbox"/> Loose or broken box/socket <input type="checkbox"/> <input type="checkbox"/> Live parts of machine or equipment exposed <input type="checkbox"/> Motor frame not earthed
ক্যাপ আইটেম ক্যাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Replace panel door or repair it as appropriate. <input type="checkbox"/> Repair broken/loose box or socket <input type="checkbox"/> Provide duplicate earth leads for MDB. <input type="checkbox"/> Provide earthing to body & door. <input type="checkbox"/> Provide clear identification mark on distribution board and SLD <input type="checkbox"/> Provide earthing to motor frames.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০১-০৯-২০১৬
সংশোধিত সময়সীমা	০১-০৯-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation :Panel door damaged/not present. Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 07-06-2021: Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 31-08-2021: Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 21-08-2022 : 1. Panel door were present. 2. No instruction for first aid to electrical shock. 3. Connections without lug. 4. Undressed messy wire inside. 5. Body & door not earthed. 6. No SLD/clear identification mark for distribution board. 7. Live parts of machine or equipment exposed. 8. Motor frame not earthed. 03-04-2023 : Same as before.

সংযুক্তিসমূহ (১৪)



৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Panel door damaged/not present □ No instruction for first aid to electrical shock □ Connections without lug □ Undressed messy wire inside □ Body & door not earthed □ No SLD/clear identification mark for distribution board □ Loose or broken box/socket □ Live parts of machine or equipment exposed □ Motor frame not earthed
ক্যাপ আইটেম ক্যাটাগরি	

৫.১. কার্যক্রম

কার্যক্রম	□ Provide instructions for first aid for exposure to electrical shock □ Ensure well- dressed cabling with lugs □ Cover the exposed live parts.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	প্রয়োজ্য নয়
চূড়ান্ত সময়সীমা	০১-০৯-২০১৬
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation :Panel door damaged/not present. Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 07-06-2021: Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 31-08-2021: Connections without lug. Undressed messy wire inside. Body & door not earthed. No SLD/clear identification mark for distribution board. 21-08-2022 : 1. Panel door were present 2. No instruction for first aid to electrical shock 3. Connections without lug 4. Undressed messy wire inside 5. Body & door not earthed 6. No SLD/clear identification mark for distribution board 7. Live parts of machine or equipment exposed 8. Motor frame not earthed 03-04- 2023 : Same as before.

৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Connections without lug □ Undressed messy wiring/cables
ক্যাপ আইটেম ক্যাটাগরি	

৬.১. কার্যক্রম

কার্যক্রম	□ Ensure secured connections with lug □ Replace undressed messy wiring/cables
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০১-০৯-২০১৬
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation :Connections without lug. Undressed messy wiring/cables. 07-06-2021: Connections without lug. Undressed messy wiring/cables are found. 31-08-2021: Connections without lug. Undressed messy wiring/cables are found. 21-08-2022 : 1. Connections without lug 2. Undressed messy wiring/cables found in some DB. 03-04-2023 : Same as before.

সংযুক্তিসমূহ (৬)



৭. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	⏏ Lightning protection system not available ⏏ Improper Earth electrodes ⏏ Air terminals absent ⏏ No lightning pit
কাপ আইটেম ক্যাটাগরি	

৭.১. কার্যক্রম

কার্যক্রম	⏏ Provide appropriate Lightning protection system. ⏏ Provide air terminals ⏏ Lightning pit should be provided
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	Initiative has not taken yet but factory personnel agreed to implement within timeline.
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	২১-০১-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	11-02-2020 Visit Observation :Not Started anything yet on this issue. 01-02-2021 Visit Observation: On the factory roof top Lightning protection system is not installed. Improper Earth electrode. Air terminals absent. No lightning pit. But they have submitted design for approval. 07-06-2021: On the factory roof top Lightning protection system is not installed. Improper Earth electrode. Air terminals absent. No lightning pit. But they have submitted design for approval. 31-08- 2021: The factory roof top Lightning protection system is not installed. Improper Earth electrode. Air terminals absent. No lightning pit. But they have submitted design for approval. 21-08-2022 : 1. Lightning protection system not available but they have submitted design for approval. 03-04-2023 : Same as before.

সংযুক্তিসমূহ (৪)

