



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার  
শ্রম ও কর্মসংস্থান মন্ত্রণালয়  
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

শ্রমজীবী মানুষের অধিকার, বৈষম্যহীন  
বাংলাদেশের অঙ্গীকার

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	মেসার্স হাবিব এম্পায়েন্স লিঃ	
ঠিকানা	PLOT NO-653, D.E.P.Z ROAD, VILL-ZIRABO, P.O.-ZIRABO, P.S-ASHULIA, Dhaka	
কারখানার কোড	DHK241	
কালার কোড		
মূল্যায়নের ধরণ: <b>বেদ্বিতিক মূল্যায়ন</b>		পর্যবেক্ষণের তারিখ: -
১. পর্যবেক্ষণ		

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ One point frame earthing of generator instead of two
ক্যাপ আইটেম ক্যাটাগরি	

### ১.১. কার্যক্রম

কার্যক্রম	Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We will engage a DIFE listed consultancy firm to complete this issue.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৪-০৮-২০১৭
সংশোধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	on 12-03-2020 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is now earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 30.05.2021 on visit day Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point. On 22/08/2021: Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point.

### ২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ One point frame earthing of generator instead of two
ক্যাপ আইটেম ক্যাটাগরি	

### ২.১. কার্যক্রম

কার্যক্রম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room □ Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We will engage a DIFE listed consultancy firm to complete this issue.
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	১৪-১০-২০১৭
সংশোধিত সময়সীমা	০৪-০১-২০২৩
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	on 12-03-2020 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is now earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 30.05.2021 on visit day Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point. On 22/08/2021: Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point.

### ৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door ☐ No detector in generator room ☐ One point frame earthing of generator instead of two
ক্যাপ আইটেম ক্যাটাগরি	

### ৩.১. কার্যক্রম

কার্যক্রম	Ensure double earthing of generator frame
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We will complete this issue within given timeline.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১৪-০৮-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	on 12-03-2020 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is now earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 23-12-2020 Visit Observation: 1. Generator is located on ground floor, they haven't provided any separation. 2. Inadequate fire separation for Generator. 3. No detector is found inside the generator room 4. generator is not earthed at two point. 30.05.2021 on visit day Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point. On 22/08/2021: Generator is located on ground floor, they haven't provided any separation. Inadequate fire separation for Generator. No detector is found inside the generator room. generator is now earthed at two point.

### ৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	No instruction for first aid to electrical shock ☐ No clear identification mark on distribution board ☐ Access obstructed/barred ☐ Visible burn marks ☐ Connection without lug ☐ Undressed messy wire inside ☐ Door not earthed ☐ MCB installed on the wooden board
কাপ আইটেম ক্যাটাগরি	

#### ৪.১. কার্যক্রম

কার্যক্রম	Provide earthing to door. ☐ Identify cause of burning inside distribution box and take remedial measures ☐ Provide clear identification mark on distribution board. ☐ Install MCB on metal board.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We will complete this issue within given timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৪-১০-২০১৭
সংশোধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	on 12-03-2020 Electrical single line diagram and layout drawings are not available at site. 1.No identification marking in distribution board. 2.No instruction board for first aid to electrical shock and artificial respiration. 3.Body & Door of DB is not properly earthed. 4.Cables were not well dressed but found to be terminated with lugs. 5.MCB installed on the wooden board. 6. visible burn markes is observed inside the panel board. 23-12-2020 Visit Observation:1.No identification marking in distribution board. 2.No instruction board for first aid to electrical shock and artificial respiration. 3.Body & Door of DB is not properly earthed. 4.Cables were not well dressed but found to be terminated with lugs. 5.MCB installed on the wooden board. 6. visible burn markes is observed inside the panel board. 30.05.2021 on visit day No identification marking in distribution board.No instruction board for first aid to electrical shock and artificial respiration.Body & Door of DB is not properly earthed. Cables were not well dressed but found to be terminated with lugs. MCB installed on the wooden board. visible burn markes is observed inside the panel board. On 22/08/2021: No identification marking in distribution board.No instruction board for first aid to electrical shock and artificial respiration.Body & Door of DB is not properly earthed. Cables were not well dressed but found to be terminated with lugs. MCB installed on the wooden board. Visible burn markes is observed inside the panel board.

#### ৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	No instruction for first aid to electrical shock ☐ No clear identification mark on distribution board ☐ Access obstructed/barred ☐ Visible burn marks ☐ Connection without lug ☐ Undressed messy wire inside ☐ Door not earthed ☐ MCB installed on the wooden board
কাপ আইটেম ক্যাটাগরি	

#### ৫.১. কার্যক্রম

কার্যক্রম	Provide instructions for first aid from exposure to electrical shock ☐ Remove obstruction to ensure access to MDB/MCB Box ☐ Ensure well-dressed cabling with lugs
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We will complete this issue within given timeline.
অগ্রাধিকার	প্রয়োজ্য নয়
চূড়ান্ত সময়সীমা	১৪-১০-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	on 12-03-2020 Electrical single line diagram and layout drawings are not available at site. 1.No identification marking in distribution board. 2.No instruction board for first aid to electrical shock and artificial respiration. 3.Body & Door of DB is not properly earthed. 4.Cables were not well dressed but found to be terminated with lugs. 5.MCB installed on the wooden board. 6. visible burn markes is observed inside the panel board. 23-12-2020 Visit Observation:1.No identification marking in distribution board. 2.No instruction board for first aid to electrical shock and artificial respiration. 3.Body & Door of DB is not properly earthed. 4.Cables were not well dressed but found to be terminated with lugs. 5.MCB installed on the wooden board. 6. visible burn markes is observed inside the panel board. 30.05.2021 on visit day No identification marking in distribution board.No instruction board for first aid to electrical shock and artificial respiration.Body & Door of DB is not properly earthed. Cables were not well dressed but found to be terminated with lugs. MCB installed on the wooden board. visible burn markes is observed inside the panel board. On 22/08/2021: No identification marking in distribution board.No instruction board for first aid to electrical shock and artificial respiration.Body & Door of DB is not properly earthed. Cables were not well dressed but found to be terminated with lugs. MCB installed on the wooden board. Visible burn markes is observed inside the panel board.