

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্ববেষ্ফণের তথ্য

	भाসूप थ्याপाखनम निः
ঠিকানা	H-79 Block-D, (4th Floor), Int. Airport Road, Chairmanbari
কারখানার কোড	DHK363
কালার কোড	

: বৈঘুত্তিক মূল্যায়ন	পর্ববেষ্ফণের তারিখ: 🕒		
১. প্ৰ্ববেষ্ণণ			
পরিদর্শন The generator room smaller than the required size No firefighting equipment is পর্শবেক্ষণ present in the generator room Combustible materials inside generator room ক্যাপ আইটেম ক্যাটাগরি			
Provide firefighting equipment as required by	the Guidelines		
No action has been taken for generator room si complete within timeline. Rest of the non–confo প্রযোগ্য ন্য			
25-09-5076			
07-07-7940			
চলমাল			
CCV Date: 19-07-2020 Fire fighting equipment not adequate enough required according to NTF 1. The generator room is not appropriately sized generator to perform routine maintenance activition for generator room. 11-08-2021 on visit appropriately sized in order to properly access maintenance activities 2. Not enough fire equipment.	PA guideline On 11–11–2020 (CVV), in order to properly access the vities. 2.Not enough fire equipment day 1.The generator room is not the generator to perform routine		
	The generator room smaller than the required sizesent in the generator room \(\text{Combustible mate} \) I Provide firefighting equipment as required by No action has been taken for generator room sizes complete within timeline. Rest of the non-conformation of sizes and sizes are sizes as a size of the non-conformation of sizes are sizes as a size of s		

২. পর্যবেষ্ণণ

পরিদর্শন	☐ The generator room smaller than the required size ☐ No firefighting equipment is
পর্ববেষ্কণ	present in the generator room 🛘 Combustible materials inside generator room
ক্যাপ	
আইটেম	
ক্যাটাগরি	

.১. কাৰ্যক্ৰম	
কাৰ্যক্ৰম	Remove Combustible materials from generator room and keep it clean
সুপারিশের তথ্যসূত্র	
কার্থানার কার্বক্রম	Action has been taken.
অগ্রাধিকার	প্র্যোগ্য ন্য
চুডান্ত সময়সীমা	_
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	চলমান
	CCV Date: 19-07-2020 Combustible material observed inside the generator room On 11-11-2020 (CVV), 1. Combustible materials have not been removed from the generator room 11-08-2021 on visit day Combustible materials have not been removed from the generator room

৩. পর্ববেষ্ণণ

| No SLD/clear identification mark for MDB/DB/SDB | Access obstructed/barred | Visible burn marks | Live parts of machine or equipment exposed | MDB/DB/SDB/SB or MCB installed on the wooden board | Combustible material near or inside | প্ৰবিশ্বৰ

৩.১. কার্যক্রম ☐ Provide clear identification mark on MDB/DB/SDB and provide SLD ☐ Find cause of burning inside DBs and take appropriate actions ☐ Install কাৰ্যক্ৰম MDB/DB/SDB/SB/MCCB on noninflammable board. Provide earthing to body and door of MDB/DB/SDB. Provide earthing to motor body. Repair broken/loose box or socket [] Provide duplicate earth leads for MDB. সুপারিশের ত্তখ্যসূত্র কারখানার No action has been taken but they have agreed to complete within timeline. কাৰ্যক্ৰম **অগ্রাধিকার** প্রযোগ্য নর চড়ান্ত 25-02-5028 সমশ্বসীমা সংশোধিত 05-05-5590 সময়সীমা অগ্রগতির <u> </u> ज्ञान অবস্থা CCV Date: 19-07-2020 1. Clear identification for the distribution boards were not lebelled 2. Burning sign observed in some cables connected to MCB 3. Cut-off switch board and some MCCB and meter are installed on a wooden board 4. Distribution boards were earthed but door of the distribution boards were not grounded 5. Earthing was not provided in some motor body of the machine 6. Loose socket observed on a light cable channel 7. Single earth lead provided for MDB On 11–11–2020 (CVV), 1.No clear identification markings of distribution panels. 2. Burning sign observed 3. Cut-off switch board and some MCCB and meter are installed on a wooden board 4.Body & Door of DB is not properly earthed. Total মন্তবা system earthling is not properly done as per NTPA. 5.All metal in the building is not connected to the building earthling system. 6.Loose socket observed on a light cable channel 7. Connections with lug 8. Single earth lead provided for MDB 11-08-2021 on visit day 1.No clear identification markings of distribution panels, 2.Burning sign observed 3.Cut-off switch board and some MCCB and meter are installed on a wooden board 4.Body & Door of DB is not properly earthed. Total system earthling is not properly done as per NTPA. 5.All metal in the building is not connected to the building earthling system. 6.Loose socket observed on a light cable channel 7. Connections with lug 8. Single earth lead provided for MDB

পরিদর্শন পর্ববেষ্কণ	No SLD/clear identification mark for MDB/DB/SDB Access obstructed/barred Visible burn marks Live parts of machine or equipment exposed MDB/DB/SDB/SB or MCB installed on the wooden board Combustible material near or inside MDB/DB/SDB body and door not earthed Motor body not earthed Undressed messy wire inside Connections without lug Loose or broken box/socket MDB does not have duplicate earth leads
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্ৰম				
কাৰ্যক্ৰম	Remove obstruction to ensure access to MDB/DB/SDB/MCB/MCCB/SB Ens all connection with lugs and proper cable dressing Cover the exposed live part Remove combustible material from near or inside MDB/SDB/SB/MCCB			
সুপারিশের তখ্যসূত্র				
কারখানার কার্যক্রম	No action has been taken but they have agreed to complete within timeline.			
অগ্রাধিকার	প্রযোগ্য নয়			
চুডান্ড সময়সীমা	√6-0β-50√9			
সংশোধিত সময়সীমা	07-07-7940			
অগ্রগতির অবস্থা	চলমান			
মন্তব্য	CCV Date: 19–07–2020 1. Obstruction infront some of the distribution boards 2. Cable connection were connected with proper sized lugs in bus bar of some distribution boards and cables were not dressed properly in some distribution boards 3. Unterminated cable found in some distribution boards and in cable light channels 4. Combustible found near distribution boards On 11–11–2020 (CVV), 1. Obstruction infront some of the distribution boards 2. Cable connection were connected with proper sized lugs in bus bar of some distribution boards and cables were not dressed properly in some distribution boards 3. Unterminated cable found in some distribution boards and in cable light channels 4. Combustible found near distribution boards 2. Cable connection were connected with proper sized lugs in bus bar of some distribution boards and cables were not dressed properly in some distribution boards 3. Unterminated cable found in some distribution boards and in cable light channels 4. Combustible found near distribution boards 4. Combustible found near distribution boards			

৫. পর্ববেষ্ণণ

পরিদর্শন পর্শবেষ্কণ	Connections without lug [] Undressed messy wiring/cables
ক্যাপ্	
<u>আইটেম</u>	
ক্যাডাগার	

কাৰখানাৰ No action has been taken but they have agreed to complete within timeline.

অগ্রাধিকান ৬ সপ্তাহ

চড়ান্ত

ত্বুঙাঙ সময়সীমা সংশোধিত

भरतामिक | अभयभीमा | ०५-०५-५৯१०

অগ্রগতির অবস্থা

CCV Date: 19-07-2020 1. Cables connected to bus bar in some distribution boards without proper sized lugs 2. Cables were not dressed properly in some distribution boards On 11-11-2020 (CVV) , 1. Cables connected to bus bar in some distribution boards without proper sized lugs 2. Cables were not dressed properly in some distribution boards 11-08-2021 on visit day 1. Cables connected to bus bar in some distribution boards without proper sized lugs 2. Cables were not dressed properly in some distribution boards

৬. পর্যবেষ্ণণ

মন্তব্য

পরিদর্শন 🛮 Lightning protection system not available 🖟 Improper Earth electrodes 🖟 Air terminals পর্যবেষ্ষণ absent 🖟 No earthing/lightning pit

ক্যাপ আইটেম ক্যাটাগরি

৬.১. কাৰ্যক্ৰম

কাশক্র	☐ Provide appropriate Lightning protection system. ☐ Provide air terminals ☐			
	Earthing/lightning pit must be identified			
সুপারিশের				
ভিখ্যসূত্র				
কারখানার	No action has been taken but they have a model to complete within timeline			
কাৰ্যক্ৰম	No action has been taken but they have agreed to complete within timeline.			
<u>অগ্রা</u> খিকার	৬ মাস			
চুডান্ড	07-05-3074			
সময়সীমা	29-04-4091			
সংশোধিত				
সময়সীমা	02-02-2040			
<u>অগ্রগতির</u>	च्या न			
<u>অবস্থা</u>				
	CCV Date: 19-07-2020 Lightning protection design found in the factory but factory			
মন্তব্য	has not installed LPS yet On 11-11-2020 (CVV), Lightning protection design found			
	in the factory but factory has not installed LPS yet. 11-08-2021 on visit day			
সমরসীমা অগ্রগতির অবস্থা	1			