

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার

শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্ববেষ্ফণের তখ্য

| কারখানার নাম | আর টেক্স ফ্যাশন লিঃ |
|--------------|---------------------------------|
| ঠিকানা | 146, Satarkul Road, North Badda |
| কারখানার কোড | DHK476 |
| কালার কোড | |

| মূল্যায়নের ধরণ: বৈঘুতিক মূল্যায়ন | পর্ববেষ্ডণের তারিখ: ০৩–০৪–২০২৩ |
|------------------------------------|--------------------------------|
| ১. পর্ববেষ্ণণ | |

| পরিদর্শন পর্শবেষ্ফণ | ☐ The generator room smaller than the required size ☐ The generator room is not properly segregated from the rest of the occupancy ☐ No detector in generator room ☐ No firefighting equipment is present in the generator room ☐ No earthing ☐ No over current or earth fault protection provided |
|-----------------------------|--|
| ক্যাপ আইটেম ক্যাটাগরি | |

| ১. কাৰ্যক্ৰম | |
|------------------------|--|
| কাৰ্শক্ৰম | Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. Provide firefighting equipment as required by the Guidelines. Provide over current and earth fault protection |
| সুপারিশের তথ্যসূত্র | |
| কারখানার কার্বক্রম | |
| <u> অগ্রাখিকার</u> | ৬ সপ্তাহ |
| চুডান্ত সময়সীমা | _ |
| সংশোধিত সমশ্বসীমা | 02-02-2290 |
| অগ্রগতির অবস্থা | চলমান |
| ম ন্তব্য | 19/10/2020: 1. Factory hasn't produced fire separation design drawing yet. 2. Fire fighting equipment was available in generator room. 3. Over current protection was provided but earth fault protection was not provided. 04/01/2021: 1. Factory hasn't produced fire separation design drawing yet. 2. Fire fighting equipment was available in generator room. 3. Over current protection was provided but earth fault protection was not provided. 07-09-2021: Factory hasn't produced fire separation design drawing yet. Fire fighting equipment was available in generator room. Over current protection was provided but earth fault protection was not provided. 03-08-2022 visit observation: 1.Factory hasn't produced fire separation design drawing yet. 2.Fire fighting equipment was available in generator room. 3.Over current protection was provided but earth fault protection was not provided. 03.04.2023: 1.Factory hasn't produced fire separation design drawing yet. 2.Fire fighting equipment was available in generator room. 3.Over current protection was provided but earth fault protection was provided. |

| পরিদর্শন পর্শবেষ্ফণ | ☐ The generator room smaller than the required size ☐ The generator room is not properly segregated from the rest of the occupancy ☐ No detector in generator room ☐ No firefighting equipment is present in the generator room ☐ No earthing ☐ No over current or earth fault protection provided |
|-----------------------------|--|
| ক্যাপ আইটেম ক্যাটাগরি | |

২.১. কাৰ্যক্ৰম Provide fire rated enclosure from floor to P27.3 ceiling and an approved fire rated কাৰ্যক্ৰম selfclosing swing door for the Generator room [] Install appropriate detectors. সুপারিশের ভখ্যসূত্র কারখানার কাৰ্যক্ৰম **অগ্রাধিকার|**৬ মাস চুড়ান্ত <u> नेभग्रनी</u>भा সংশোধিত 02-02-2290 সমশ্রসীমা অগ্রগতির শুৰু হয়নি অবস্থা 19/10/2020: 1. fire rated enclosure and fire rated doors were not present in the generator room. 2. Appropriate detectors have not been installed yet. 04/01/2021: 1. fire rated enclosure and fire rated doors were not present in the generator room. 2. Appropriate detectors have not been installed yet. 07-09-2021: Fire rated enclosure and fire rated doors were not present in the generator room. Appropriate মন্তব্য detectors have not been installed yet. 03-08-2022 visit observation: 1. Fire rated enclosure and fire rated doors were not present in the generator room. 2. Appropriate detectors have not been installed yet. 03.04.2023: 1. Fire rated enclosure and fire rated doors were not present in the generator room. 2. Appropriate detectors have not been installed yet. সংখুক্তিসমূহ (২)

৩. পর্ববেষ্ষণ

| পরিদর্শন পর্ববেষ্ফণ | ☐ The generator room smaller than the required size ☐ The generator room is not properly segregated from the rest of the occupancy ☐ No detector in generator room ☐ No firefighting equipment is present in the generator room ☐ No earthing ☐ No over |
|------------------------|---|
| | current or earth fault protection provided |
| ক্যাপ | · |
| আইটেম | |
| ক্যাটাগরি | |
| | |
| ৩.১. কা- | ক্রিম |
| কাৰ্যক্ৰম | Ensure double earthing of generator frame |
| সূপারিং | |
| ভিখ্যসূত্র | |
| কার্নখা | |
| কাৰ্যক্ৰম | |
| <u>অগ্রা</u> খি | চার প্রযোগ্য নয় |
| চুডান্ড | |
| সম্প্রমী | ना ⁻ |
| সংশোধি | |
| সমশ্বসী | 에 |
| অগ্ৰগত্তি | ষ্ট্ৰ হুগুলি |

19/10/2020: Double earthing of generator frame is not ensured. 04/01/2021:

observation: Double earthing of generator frame has not been ensured yet. 03.04.2023: Double earthing of generator frame has not been ensured yet.

Double earthing of generator frame has not been ensured yet. 07-09-2021: Double earthing of generator frame has not been ensured yet. 03-08-2022 visit

সংযুক্তিসমূহ (৩) × × ×

৪. পর্ববেষ্ণণ

মন্তব্য

| পরিদর্শন পর্ববেষ্ফণ | ☐ No instruction for first aid to electrical shock ☐ Cable ends not properly soldered or crimped ☐ Connection without lug ☐ Undressed messy wire inside ☐ Body & door not earthed ☐ No clear identification mark on distribution board ☐ MDB/SDB/SB or MCB installed on the wooden board |
|-----------------------------|--|
| ক্যাপ আইটেম ক্যাটাগরি | |

৪.১. কার্যক্রম Provide earthing to body & door. Provide clear identification mark on কাৰ্যক্ৰম distribution board. I Install MDB/SDB/SB or MCB on metal board. সুপারিশের ভখ্যসূত্র কারখানার কাৰ্যক্ৰম **অগ্রাধিকার|**৬ সপ্তাহ চডান্ড **म**भग्नमीभा সংশোধিত 05-05-5590 সময়সীমা অগ্রগতির চলমান অবস্থা 19/10/2020: 1. Door earthing was not found in any of the boards. Body earthing was present in some of the boards. 2. Clear identification marks were not provided on any of the boards. 3. Some of the switchboards were installed on wooden boards. All the other boards were installed on metal boards. 04/01/2021: 1. Door earthing was not found in most of the boards. Only one board has door earthing. Body earthing was present in some of the boards. 2. Clear identification marks were not provided on any of the boards. 3. Some of the switchboards were installed on wooden boards. All the other boards were installed on metal boards. 07-09-2021: Door earthing was not found in most of the boards. Only one board has door earthing. Body earthing was present in some of the boards. Clear মন্তব্য identification marks were not provided on any of the boards. Some of the switchboards were installed on wooden boards. All the other boards were installed on metal boards. 03-08-2022 visit observation: 1. Panel board & door earthing were not found properly in distribution board. 2.Clear identification marks were not found on distribution board. 3. Some of the switchboards were installed on wooden boards. All the other boards were installed on metal boards, 03.04,2023: 1.Panel board & door earthing were not found properly in distribution board. 2. Clear identification marks were not found on distribution board. 3. Some of the switchboards were installed on wooden boards. All the other boards were installed on metal boards. সংশক্তিসমূহ (৬) x x x

| পরিদর্শন পর্ববেষ্ফণ | No instruction for first aid to electrical shock Cable ends not properly soldered or crimped Connection without lug Undressed messy wire inside Body & door not earthed No clear identification mark on distribution board MDB/SDB/SB or MCB installed on the wooden board |
|-----------------------------|--|
| ক্যাপ আইটেম ক্যাটাগরি | |

৫.১. কাৰ্যক্ৰম $oxedsymbol{\mathbb{I}}$ Provide instructions for first aid from exposure to electrical shock $oxedsymbol{\mathbb{I}}$ Ensure well– কাৰ্যক্ৰম dressed cabling with lugs সুপারিশের ভখ্যসূত্র কারখানার কাৰ্যক্ৰম **অগ্রাধিকার** প্রযোগ্য নয় চুড়ান্ত <u> नेभग्रनी</u>भा সংশোধিত 02-02-2290 সময়সীমা অগ্রগতির শুৰু হয়নি অবস্থা 19/10/2020: 1. Instructions for first aid from exposure to electrical shock were not provided. 2. Cables were not well dressed. Cable looping was present in all the boards. 04/01/2021: 1. Instructions for first aid from exposure to electrical shock were not provided. 2. Cables were not well dressed. Cable looping was present in all the boards. 07-09-2021: Instructions for first aid from exposure to electrical মন্তব্য shock were not provided. Cables were not well dressed. Cable looping was present in all the boards. 03-08-2022 visit observation: 1.Instructions for first aid from exposure to electrical shock were not found. 2. Cables were not well dressed. 3. Cable looping were found. 03.04.2023: 1. Instructions for first aid from exposure to electrical shock were not found. 2. Cables were not well dressed. 3. Cable looping were found. সংখুক্তিসমূহ (৬)

৬. পর্যবেষ্ণণ

| পরিদর্শন পর্ববেষ্কণ | Electric cables do not pass through service shaft or insulated conduits Connections without lug Undressed messy wiring/cables Cable ends not properly soldered or crimped |
|-----------------------------|--|
| ক্যাপ আইটেম ক্যাটাগরি | |

| ক্যাটাগরি | | |
|-------------------------------|--|--|
| | | |
| ৬.১. কাৰ্যক্ৰঃ | <u>1</u> | |
| কাৰ্যক্ৰম | Provide service ducts or insulated conduits Ensure secured connections with lug Replace undressed messy wiring/cables Properly solder cable ends | |
| সুপারিশের তখ্যসূত্র | | |
| কার্থানার কার্বক্রম | | |
| অগ্রাধিকার | ৬ সপ্তাহ | |
| চুড়ান্ত সময়সীমা | _ | |
| সংশোধিত সময়সীমা | 07-07-7940 | |
| অগ্রগতির অবস্থা | চলমাল | |
| মন্তব্য | 19/10/2020: 1. Service ducts or insulated conduits were not provided for most of the cables. 2. Secured connections with lugs were provided for most of the wires. 3. Undressed messy wirings were found. 4. Cable ends were not properly soldered. 04/01/2021: 1. Service ducts or insulated conduits were not provided for most of the cables. 2. Secured connections with lugs were provided for most of the wires. 3. undressed messy wirings were found. 4. cable ends were not properly soldered. 07-09-2021: Service ducts or insulated conduits were not provided for most of the cables. Secured connections with lugs were provided for most of the wires. Undressed messy wirings were found. Cable ends were not properly soldered. 03-08-2022 visit observation: 1. Service ducts or insulated conduits were not provided. 2. Secured connections with lugs were found. 3. Undressed messy wiring/cable were found. 4. Cable ends were not properly soldered. 03.04.2023: 1. Service duct or insulated service cable were not provided 2. Connection found with out lug. 3. Undress messy waring cable was found during visit. 4. Cable end were not properly soldered. | |
| সংখুক্তিসমূহ (৬) × × × × × | | |

৭. পর্যবেষ্ণণ

| পরিদর্শন 🛮 Lightning protection system not available | |
|--|--|
| ক্যাপ আইটেম ক্যাটাগরি | |
| ৭.১. কাৰ্বক্ৰম | |
| কাৰ্যক্রম 📗 Provide appropriate Lightning protection system. | |
| সুপারিশের ভখ্যসূত্র | |
| কার্থানার কার্যক্রম | |
| অগ্রাধিকার ৬ মাস | |
| চ্যুড়ান্ত সময়সীমা | |
| সংশোধিত সময়সীমা | |
| অ্থগতির অবস্থা | |
| 19/10/2020: Factory has provided Lightning protection system design to DIFE for approval. 04/01/2021: Factory has provided Lightning protection system design to DIFE for approval. 07-09-2021: Factory has provided Lightning protection system design to DIFE for approval. 03-08-2022 visit observation: LPS Drawing approved by DIFE. Factory not yet installed LPS system. 03.04.2023: LPS design approved by DIFE at 58th task force, but factory not installation work yet. | |
| সংযুক্তিসমূহ (8) x x x x | |