



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখালা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

| | |
|--------------|----------------------------|
| কারখালার নাম | কাইলার্ক লীট কম্পান্সি লিঃ |
| ঠিকানা | 182, Bhorari, Rajfulbaria |
| কারখালার কোড | DHK550 |
| কালার কোড | |

| | |
|---|---------------------------------------|
| মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন | পর্যবেক্ষণের তারিখ: ০৯-০৮-২০২৩ |
| ১. পর্যবেক্ষণ | |

| | |
|-----------------------------|---|
| পরিদর্শন পর্যবেক্ষণ | □ Access obstructed/barred □ Cable ends not properly soldered or crimped □ Connection without lug □ Undressed messy wire inside □ Body & door not earthed □ No instruction for first aid to electrical shock □ No clear identification mark on distribution board |
| ক্যাপ আইটেম ক্যাটাগরি | |

১.১. কার্যক্রম

| | |
|------------------------|--|
| কার্যক্রম | □ Repair broken/loose MCCB/MCB box. □ Provide duplicate earth leads. □ Provide earthing to body & door. □ Provide earth bar/neutral bar □ Identify cause of burning inside distribution box and take remedial measures □ Provide clear identification mark on distribution board. □ Install MDB/SDB/SB or MCB on metal board. |
| সুপারিশের তথ্যসূত্র | |
| কারখানার কার্যক্রম | Initiative has been taken for clear identification mark on distribution board & committed to complete within timeline. Rest of the non-conformities has been resolved. |
| অগ্রাধিকার | ৬ সপ্তাহ |
| চূড়ান্ত সময়সীমা | ২৯-০৯-২০১৬ |
| সংশোধিত সময়সীমা | ০৯-০৯-১৯৭০ |
| অগ্রগতির অবস্থা | চলগাল |
| মন্তব্য | 05-05-2021 (CVV) : Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6. MDB/DB/SDB cable ends properly sealed. 31-08-2021 : Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6. MDB/DB/SDB cable ends properly sealed. 23-08-2022 : 1. Access obstructed/barred 2. Cable ends not properly soldered or crimped 3. Connection without lugs 4. Undressed messy wire are not found in DB. 5. Body & door not earthed 6. No instruction for first aid to electrical shock 7. No clear identification mark on distribution board 09-04-2023: 1. Access obstructed/barred was not found. 2. Cable ends not properly soldered or crimped. 3. Connection without lugs was found. 4. Undressed messy wire were not found in DB. 5. Body & door was not earthed. 6. No instruction for first aid to electrical shock was found as required places. 7. No clear identification mark on distribution board. |

সংযুক্তিমূহ (১২)



২. পর্যবেক্ষণ

| | |
|-----------------------------|---|
| পরিদর্শন পর্যবেক্ষণ | □ Access obstructed/barred □ Cable ends not properly soldered or crimped □ Connection without lug □ Undressed messy wire inside □ Body & door not earthed □ No instruction for first aid to electrical shock □ No clear identification mark on distribution board |
| ক্যাপ আইটেম ক্যাটাগরি | |

২.১. কার্যক্রম

| | |
|----------------------------|---|
| কার্যক্রম | □ Provide instructions for first aid from exposure to electrical shock □ Remove obstruction to ensure access to MDB/MCB Box □ Ensure well-dressed cabling with lugs □ Encase live machine and/or equipment parts |
| সুপারিশের তথ্যসূত্র | |
| কার্যক্রম কার্যক্রম | Initiative has been taken & agreed to complete within timeline. |
| অধ্যাধিকার প্রযোজ্য নথি | |
| চূড়ান্ত সময়সীমা | ২৪-০৮-২০১৬ |
| সংশোধিত সময়সীমা | ০৯-০৯-১৯৭০ |
| অঞ্চলিক অবস্থা | চলগাল |
| মন্তব্য | 05-05-2021 (CVV) : Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6. MDB/DB/SDB cable ends properly sealed. 31-08-2021 : Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6. MDB/DB/SDB cable ends properly sealed. 23-08-2022 : 1. Access obstructed/barred. 2. Cable ends not properly soldered or crimped. 3. Connection without lug. 4. Undressed messy wire are not found in DB. 5. Body & door not earthed. 6. No instruction for first aid to electrical shock. 7. No clear identification mark on distribution board. 09-04-2023: 1. Access obstructed/barred was not found. 2. Cable ends not properly soldered or crimped. 3. Connection without lugs was found. 4. Undressed messy wire were not found in DB. 5. Body & door was not earthed. 6. No instruction for first aid to electrical shock was found as required places. 7. No clear identification mark on distribution board. |
| সংযুক্তিমূল্য (৬) | <input checked="" type="checkbox"/> |

৩. পর্যবেক্ষণ

| | |
|---------------------------|---|
| পরিদর্শন পর্যবেক্ষণ | <input type="checkbox"/> Electric cables do not pass through service shaft or insulated conduits <input type="checkbox"/> Undressed messy wiring/cables |
| কাপ আইটেম ক্যাটাগরি | |

৩.১. কার্যক্রম

| | |
|---|---|
| কার্যক্রম | <input type="checkbox"/> Provide service ducts or insulated conduits <input type="checkbox"/> Ensure secured connections with lug <input type="checkbox"/> Replace undressed messy wiring/cables <input type="checkbox"/> Properly solder cable ends |
| সুপারিশের তথ্যসূত্র | |
| কান্সালার কার্যক্রম | Initiative has been taken & agreed to complete within timeline. |
| অধ্যাধিকার | প্রযোজ্য নয় |
| চূড়ান্ত সময়সীমা | ২৯-০৯-২০১৬ |
| সংশোধিত সময়সীমা | ০৯-০৯-১৯৭০ |
| অগ্রগতির অবস্থা | শুরু হয়নি |
| মন্তব্য | 05-05-2021 (CVV) : 1. Electric cables do not pass through service shaft or insulated conduits. 2. Proper size lugs are not present in DB. 31-08-2021: 1. Electric cables do not pass through service shaft or insulated conduits. 2. Proper size lugs are not present in DB. 23-08-2022 : 1. Electric cables do not pass through service shaft or insulated conduits. 2. Undressed messy wiring/cables found. 09-04-2023: 1. Electric cables do not pass through service shaft or insulated conduits. 2. Undressed messy wiring/cables was found. |
| সংযুক্তমন্তব্য (8) | |
| <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> | |