

## গণপ্রজাতন্ত্রী বাংলাদেশ সরকার

শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

## ক্যাপ পর্ববেষ্ফণের তখ্য

কারখানার নাম	ষাইলাৰ্ক নীট কম্পোজিট লিঃ
ঠিকানা	182, Bhorari, Rajfulbaria
কারখানার কোড	DHK550
কালার কোড	

মুল্যারনের ধরণ: বৈঘুতিক মূল্যারন	পর্ববেষ্ডণের তারিখ: ০	<i>5</i> −08−२0२७
১. পর্যবেষ্কণ		

Access obstructed/barred | Cable ends not properly soldered or crimped | পরিদর্শন Connection without lug | Undressed messy wire inside | Body & door not earthed | No পর্যবেষ্ণন instruction for first aid to electrical shock | No clear identification mark on distribution board
ক্যাপ
আইটেম
ক্যাউাগরি

## ১.১. কাৰ্যক্ৰম Repair broken/loose MCCB/MCB box. Provide duplicate earth leads. Provide earthing to body & door. $\square$ Provide earth bar/neutral bar $\square$ Identify cause of কাৰ্যক্ৰম burning inside distribution box and take remedial measures [] Provide clear identification mark on distribution board. I Install MDB/SDB/SB or MCB on metal board. সুপারিশের ভখ্যসূত্ৰ Initiative has been taken for clear identification mark on distribution board & কারখানার committed to complete within timeline. Rest of the non-conformities has been কাৰ্যক্ৰম resolved. **অগ্রাধিকার** ৬ সপ্তাহ চডান্ত 22-02-2028 সংশোধিত 05-05-5590 সমশ্বসীমা অগ্রগতির চলমান অবস্থা 05-05-2021 (CVV) : Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6.MDB/DB/SDB cable ends properly sealed. 31-08-2021: Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not মন্তব্য present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6.MDB/DB/SDB cable ends properly sealed. 23-08-2022 : 1. Access obstructed/barred 2. Cable ends not properly soldered or crimped 3. Connection without lugs 4. Undressed messy wire are not found in DB. 5. Body & door not earthed 6. No instruction for first aid to electrical shock 7. No clear identification mark on distribution board 09-04-2023: 1. Access obstructed/barred was not found. 2. Cable ends not properly soldered or crimped. 3.Connection without lugs was found. 4. Undressed messy wire were not found in DB. 5. Body & door was not earthed. 6. No instruction for first aid to electrical shock was found as required places. 7. No clear identification mark on distribution board. সংশুক্তিসমূহ (১২) x x x x

Access obstructed/barred | Cable ends not properly soldered or crimped | পরিদর্শন Connection without lug | Undressed messy wire inside | Body & door not earthed | No পর্যবেষ্ণন instruction for first aid to electrical shock | No clear identification mark on distribution board
ক্যাপ
আইটেম
ক্যাউাগরি

## ২.১. কাৰ্যক্ৰম lacksquare Provide instructions for first aid from exposure to electrical shock lacksquare Remove obstruction to ensure access to MDB/MCB Box [] Ensure well-dressed cabling with কাৰ্যক্ৰম lugs | Encase live machine and/or equipment parts সুপারিশের ভখ্যসূত্ৰ কারখানার Initiative has been taken & agreed to complete within timeline. কাৰ্যক্ৰম **অগ্রাধিকার** প্রযোগ্য নয় চুড়ান্ত 28-07-2018 <u> नेभेश्र</u>नीभा সংশোধিত 05-05-5590 সময়সীমা অগ্রগতির চলমান অবস্থা 05-05-2021(CVV): Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6.MDB/DB/SDB cable ends properly sealed. 31-08-2021: Electrical single line diagram and layout drawings are not available at site. But the factory has submitted the as built and proposed SLD to DIFE for approval. 1. No instruction board for first aid to electrical shock in front of DB. 2. Proper size lugs are not present in DB. 3. Undressed messy wires are not present in DB. 4. Body & Door of DB is not properly earthed. Total system earthing মন্তব্য is not properly done as per NTPA. Need to submit earthing system design for review. 5. No identification marking on DB. 6.MDB/DB/SDB cable ends properly sealed. 23-08-2022: 1. Access obstructed/barred. 2. Cable ends not properly soldered or crimped. 3. Connection without lug. 4. Undressed messy wire are not found in DB. 5. Body & door not earthed. 6. No instruction for first aid to electrical shock. 7. No clear identification mark on distribution board. 09-04-2023: 1. Access obstructed/barred was not found. 2. Cable ends not properly soldered or crimped. 3.Connection without lugs was found. 4. Undressed messy wire were not found in DB. 5. Body & door was not earthed. 6. No instruction for first aid to electrical shock was found as required places. 7. No clear identification mark on distribution board. সংখুক্তিসমূহ (৬)

x x

পরিদর্শন	Electric cables do not pass through service shaft or insulated conduits Undressed
পর্ববেষ্কণ	messy wiring/cables
ক্যাপ	
<u>আইটেম</u>	
ক্যাটাগরি	

নাংডেশ ক্যাটাগরি			
৩.১. কাৰ্যক্ৰম			
কাৰ্যক্ৰম	Provide service ducts or insulated conduits   Ensure secured connections with lug Replace undressed messy wiring/cables   Properly solder cable ends		
সুপারিশের তখ্যসূত্র			
কার্থানার কার্বক্রম	Initiative has been taken & agreed to complete within timeline.		
<u>অগ্রা</u> ধিকার	প্রযোগ্য নয়		
চুড়ান্ড সমশ্রসীমা	₹\$-0\$-₹0\$\$		
সংশোধিত সময়সীমা	07-07-7940		
অগ্রগতির অবস্থা	শুৰু হৰ্মনি		
মন্তব্য	05-05-2021 (CVV): 1. Electric cables do not pass through service shaft or insulated conduits. 2. Proper size lugs are not present in DB. 31-08-2021: 1. Electric cables do not pass through service shaft or insulated conduits. 2. Proper size lugs are not present in DB. 23-08-2022: 1. Electric cables do not pass through service shaft or insulated conduits. 2. Undressed messy wiring/cables found. 09-04-2023: 1. Electric cables do not pass through service shaft or insulated conduits. 2. Undressed messy wiring/cables was found.		
সংখুক্তিসমূহ (8) × × ×			