

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার

শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্ববেষ্ফণের তখ্য

কারখানার নাম	এস আর বি ক্যাশনস লিঃ
ঠিকানা	13448, Satarkul Bazar,
কারখানার কোড	DHK 562
কালার কোড	

মুল্যায়নের ধরণ: বৈঘুতিক মুল্যায়ন	পর্যবেষ্ণণের তারিখ: ২৩–০১–২০২৩
১. পর্যবেষ্ণণ	

পরিদর্শন পর্ববেষ্ক্রণ	Improper separation Access to substation not easy Ventilation and illumination of substation is poor Separating wall not extended up to the ceilingt No clear identification mark on distribution panel No instruction for first aid to electrical shock and artificial respiration Non-conductor mat not provided insufficient Electric cables do not pass through service shaft or insulated conduits.
ক্যাপ আইটেম ক্যাটাগরি	

১. কাৰ্যক্ৰ	
কাৰ্শক্ৰম	☐ Provide easy access to the substation ☐ Produce design drawings to demonstrate the incorporation of fire rated enclosure and an approved fire rated door for the Substation room. ☐ Provide clear identification mark on distribution panel.
সুপারিশের তথ্যসূত্র	
কারখানার কার্বক্রম	2016-07-11 00:00:00
	প্রযোগ্য নয়
চুডান্ত সময়সীমা	26-0P-5055
সংশোধিত সময়সীমা	02-02-2290
অগ্রগতির অবস্থা	চলমাল
ম ন্তব্য	20–09–2020: Fire door installation on processing from next week. And also this cap is related with fire cap issue. 10–12–2020: Fire door installation on processing. And also this cap is related with fire cap issue. 03–03–2021: Fire door installation on processing. And also this cap is related with fire cap issue. 05–05–2021: 1. Substation room is found to be accessible. 2. Design drawings for fire separation was submitted but not approved yet. 3. Clear identification mark were missing for some distribution boards. 03–08–2022 visit observation: 1. Substation room were found accessible. 2. Design drawings for fire separation was submitted but not approved yet. 3. Clear identification mark were found missing some distribution boards. 23–01–2023 visit observation: 1. Substation room were found accessible. 2. Design drawings for fire separation was submitted but not approved yet. 3.

২. পর্যবেষ্ণণ

কাৰ্যক্ৰম	☐ Provide fire rated enclosure and approved fire rated door for the Substation room. ☐ Install appropriate detectors
সুপারিশের তখ্যসুত্র	
কার্থানার কার্বক্রম	26-03-2017
<u> অগ্রাখিকার</u>	৬ মাস
চূডান্ত সমশ্বসীমা	08-07-505@
সংশোধিত সমশ্রসীমা	02-02-2290
মগ্রগতির মবস্থা	চলমান
মন্তব্য	20–09–2020: Fire door installation on processing from next week. And also this cap is related with fire cap issue. 10–12–2020: Fire door installation on processing And also this cap is related with fire cap issue. 03–03–2021: Fire door installation on processing. And also this cap is related with fire cap issue. 05–05–2021: 1. Fire rated door was not found for the substation room to segregate it from the rest of the occupancy. 2. Appropriate detectors were not installed. 3. Insulated rubber mat were not found, instead non–graded rubber mat found. 4. Cables passes through insulated conduits. 03–08–2022 visit observation: 1.Fire rated enclosure and approved fire rated door for the substation room were not found. 2.Appropriate detectors were not found. 3.Proper fire separation were not found.

৩. পর্ববেষ্ণণ

পরিদর্শন পরিদর্শন পর্ববেষ্ণন বিদর্শন পরিদর্শন বিষয়ন বিষয়ে বিষয়ন বিষয়ে বিষয়ন বিষয়ে বিষয়ন বিষয়ে বিষয় বিষয়

৩.১. কাৰ্যক্ৰম		
কাৰ্যক্ৰম	Ensure accessibility and ventilation to substation Provide instructions for first aid and artificial respiration from exposure to electrical shock.	
সুপারিশের তথ্যসূত্র		
কারখানার কার্যক্রম	2016-03-10 00:00:00	
	প্র্যোগ্য ন্য	
চুড়ান্ড সময়সীমা	07-07-7940	
সংশোধিত সমশ্বসীমা	07-07-7940	
অগ্রগতির অবস্থা	চলমান	
মন্তব্য	20–09–2020: Found accessibility and ventilation to substation room. 10–12–2020: Found accessibility and ventilation to substation room. 03–03–2021: Found accessibility and ventilation to substation room. 05–05–2021: 1. Accessibility and ventilation of the substation room is found to be adequate. 2. Instruction boards were found beside distribution boards but was missing in the substation room and generator room. 3. Insulated rubber mat were not found, instead non–graded rubber mat found. 03–08–2022 visit observation: 1. Accessibility and ventilation of the substation room is found to be adequate. 2. Instruction for first aid & artificial respiration boards were found missing some distribution board. 3. Electric grade Insulated rubber mat were not found. 23–01–2023 visit observation: 1. Accessibility and ventilation of the substation room is found to be adequate. 2. Instruction for first aid & artificial respiration boards were found missing some distribution board. 3. Electric grade Insulated rubber mat were not found.	
সংবৃক্তিসমূহ (৬) × × × × ×		

৪. পর্যবেষ্ণণ

পরিদর্শন 📙 No instruction for first aid to electrical shock 🖟 Access obstructed/barred 🖟 No clear পর্শবেষ্কণ identification mark on distribution board		
ক্যাপ আইটেম ক্যাটাগরি		
৪.১. কাৰ্শক্ৰম		
কাৰ্যক্ৰম	Provide clear identification mark on distribution board.	
সুপারিশের ভখ্যসূত্র		
কার্থানার কার্বক্রম	2016-07-11 00:00:00	
<u>অগ্রা</u> ধিকার	প্রবোজ্য নর	
চুডান্ড সমশ্বসীমা	%€-0₽-₹0₹₹	
সংশোধিত সময়সীমা	%€-0₽-5055	
অগ্রগতির অবস্থা	চলমাল	
মন্তব্য	20–09–2020: Found clear identification mark on distribution board. 10–12–2020: Found clear identification mark on distribution board. 03–03–2021: Found clear identification mark on distribution board. 05–05–2021: Clear identification mark for some distribution boards were missing. 03–08–2022 visit observation: Clear identification mark for some distribution boards were found missing. 23–01–2023 visit observation: Clear identification mark for some distribution boards were found missing.	
সংযুক্তি × ×	সমূহ (8) × ×	

৫. পর্যবেষ্ণণ

ক্যাপ	for first aid to electrical shock Access obstructed/barred No clear rk on distribution board
অৰ্টাৰ্ভ্ৰা	
ক্যাটাগরি	

ে.১. কাৰ্যক্ৰম	
কাশক্রপ	Provide instructions for first aid from exposure to electrical shock Remove obstruction to ensure access to MDB/MCB Box.
সুপারিশের তথ্যসূত্র	
কার্থানার কার্বক্রম	2016-03-10 00:00:00
<u> অগ্রা</u> খিকার	প্রযোগ্য নয়
হুডান্ত সময়সীমা	02-02-2290
মংশো ধি ত সময়সীমা	02-02-2290
মগ্রগতির মবস্থা	চলমাল
নন্ত ব্য	20–09–2020: Removed all obstruction to ensure access to MDB/MCB Box. 10–12–2020: Removed all obstruction to ensure access to MDB/MCB Box. 03–03–2021: Removed all obstruction to ensure access to MDB/MCB Box. 05–05–2021: 1. Instruction boards were found beside distribution boards but was missing in the substation room and generator room. 2. Distribution boards/MCC/MCB box were found to be accessible. 03–08–2022 visit observation: 1. Instruction for first aid to electrical shock were found missing some distribution boards. 2. Some distribution boards were found obstructed & inaccessible. 23–01–2023 visit observation: 1. Instruction for first aid to electrical shock were found missing some distribution

৬. পর্ববেষ্ফণ

পরিদর্শন । পর্ববেষ্ফণ	Electric cables do not pass through service shaft or insulated conduits	
ক্যাপ		
আইটেম		
ক্যাটাগরি		
•		
৬.১. কাৰ্যক্ৰ	न	
কাৰ্যক্ৰম	Provide service ducts or insulated conduits	
সুপারিশের		
ভখ্যসূত্র		
কারখানার	2016-07-11 00:00:00	
কাৰ্যক্ৰম		
<u>অগ্রা</u> খিকার	প্রব্যোগ্য নর	
চুডান্ড সময়সীমা	26-0P-5055	
সংশোধিত সময়সীমা	%€-0₽-₹0₹₹	
অগ্রগতির অবস্থা	সংশোধিত	
ম্ন্তব্য	20-09-2020: Service ducts and insulated conduits found. 10-12-2020: Service ducts and insulated conduits found. 03-03-2021: Service ducts and insulated conduits found. 05-05-2021: Electric cables passes through insulated conduit. 03-08-2022 visit observation: Electric cables passes through service shaft or insulated conduit were found. 23-01-2023 visit observation: Electric cables passes through service shaft or insulated conduit were found.	
সংযুক্তিসমূহ (8) × × ×		

৭. পর্ববেষ্ণণ

পরিদর্শন পর্শবেষ্ফণ	Lightning protection system not available
ক্যাপ আইটেম ক্যাটাগরি	

৭.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম	Provide appropriate Lightning protection system.	
সুপারিশের		
ভখ্যসূত্র		
কার্খানার	26-03-2017	
কাৰ্যক্ৰম		
<u>অগ্রা</u> ধিকার	৬ মাস	
চুডান্ড সময়সীমা	08-0%-205@	
সংশোধিত সময়সীমা	07-07-7940	
অগ্রগতির অবস্থা	চলমাল	
মন্তব্য	20–09–2020: Approved design drawing found on site and LPS installation has been done. 10–12–2020: Approved design drawing found on site and LPS installation has been done. 03–03–2021: Approved design drawing found on site and LPS installation has been done. 05–05–2021: LPS was installed for the factory. 03–08–2022 visit observation: Approved LPS drawing were found & LPS Installation has been done. But some air terminal were missing & expose rubber were found. 23–01–2023 visit observation: Approved LPS drawing were found & LPS Installation has been done. But some air terminal were missing & expose rubber were found.	
200	707	

সংযুক্তিসমূহ (8) × × × ×