



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখালা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখালার নাম	চিএসআর এ্যাপারেলস লি:
ঠিকানা	House-42, Road-2, Block-E, Ward-6, Turag, Dhaka
কারখালার কোড	DHK608
কালার কোড	

মূল্যায়নের ধরণ: কাঠামোগত মূল্যায়ন	পর্যবেক্ষণের তারিখ: ০২-০৮-২০২৩
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	According to structural drawing, all floors have been shown in same level. However, in existing condition floor level are not same, West portions of the building are about 2'-2" above the East portion level.
কাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	Update calculations showing the structural adequacy of the building structure taking into account the factory design imposed loading and the as built structure.
মুপারিশের তথ্যসূত্র	
কারখনার কার্যক্রম	Structural adequacy of the building will be checked by the Engineer.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	২৭-০৩-২০১৭
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অঙ্গগতির অবস্থা	চলগাল
মন্তব্য	24.09.2018: This issue will be covered in DEA which is submitted to DIFE which is pending. Factory has submitted as built architectural drawing, as built structural drawing and floor load plan. 05.11.2018: In task force meeting they got review and ask to re submit structural analysis and vetted load plan. 04.02.2019: Consulting firm have submitted as built architectural drawing, as built structural drawing, retrofit structural drawing vetted floor load plan to DIFE dated on 06.01.19. 24.09.2020: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 28.01.21 Visit observation: The consultant firm of this factory is EQMS. The firm did not submitted the correction design drawing after 16.04.19. 03.06.2021 visit observation: Consulting firm review correction design and drawing has not submitted yet. 22/08/2022: DEA report should be prepared and resubmitted to DIFE as soon as possible. 02/4/2023: Factory have lost track of their DEA work. they are preparing to restart the DEA work. Verbally they have stated that they are willing to do the DEA work as soon as possible.

সংযুক্তিমূল্য (২)

১.২. কার্যক্রম

কার্যক্রম	Building Engineer to survey as constructed building and prepare constructed layout and elevation accordingly.
মুপারিশের তথ্যসূত্র	
কারখনার কার্যক্রম	All drawings will be prepared by the Engineer.
অগ্রাধিকার	
চূড়ান্ত সময়সীমা	২৭-০৩-২০১৭
সংশোধিত সময়সীমা	-
অঙ্গগতির অবস্থা	চলগাল
মন্তব্য	24.09.2020: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 28.01.21 Visit observation: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 03.06.2021 visit observation: Consulting firm review correction design and drawing has not submitted yet. 22/08/2022: DEA report should be prepared and resubmitted to DIFE as soon as possible. 02/4/2023: Factory have lost track of their DEA work. they are preparing to restart the DEA work. Verbally they have stated that they are willing to do the DEA work as soon as possible.

সংযুক্তিমূল্য (২)

২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Water ponding has been found in the roof top due to lack of proper drainage and slope in the roof. The source of water is due to rainfall.
ক্যাপ আইটেম ক্যাটগরি	

২.১. কার্যক্রম

কার্যক্রম	Proper slope should be maintained on the roof top. Also engineer to inspect whether waterproofing material is applied or where it can be maintained. For both durability and serviceability, waterproofing on the roof slab is recommended.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অধার্থিকার	পর্যাজ্য লব্ধ
চূড়ান্ত সময়সীমা	-
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	সংশ্লাধিত
মন্তব্য	24.09.2020: In roof top has proper drainage system. There is no water ponding. 28.01.21 Visit observation: Water ponding has not been found on visit date. The factory management repairs this issue. 03.06.2021 visit observation: No water ponding found in visit day, there has proper drainage system. 22/08/2022: No Water ponding was found on roof top and found proper drainage and slope on roof during inspection date. 02-04-2023: Completed.
সংযুক্তিমূল্য (৮)	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	