

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্ববেষ্ফণের তখ্য

কারখানার নাম	টিএসমার এ্যাপারেলস লি:
ঠিকানা	House-42, Road-2, Block-E, Ward-6, Turag, Dhaka
কারখানার কোড	DHK608
কালার কোড	

মুল্যায়নের ধরণ: কাঠামোগত মুল্যায়ন	পর্ববেষ্ফণের তারিখ: ০২–০৪–২০২৩
১. পর্যবেষ্ণণ	

পরিদর্শন পর্ববেষ্ফণ	According to structural drawing, all floors have been shown in same level. However, in existing condition floor level are not same, West portions of the building are about 2 -2 above the East portion level.
ক্যাপ আইটেম ক্যাটাগরি	

কার্ <u>থ</u> ক্রম	Update calculations showing the structural adequacy of the building structure taking into account the factory design imposed loading and the as built structure.
সুপারিশের তথ্যসূত্র	
	Structural adequacy of the building will be checked by the Engineer.
<u>অগ্রাখিকার</u>	প্রবোজ্য নর
চুডান্ড সময়সীমা	২৭-০৩-২০১৭
সংশোধিত সময়সীমা	02-02-2290
অগ্রগতির অবস্থা	চলমান
মন্তব্য	24.09.2018: This issue will be covered in DEA which is submitted to DIFE which is pending. Factory has submitted as built architectural drawing, as built structural drawing and floor load plan. 05.11.2018: In task force meeting they got review and ask to re submit structural analysis and vetted load plan. 04.02.2019: Consulting firm have submitted as built architectural drawing as built structural drawing, retrofit structural drawing vetted floor load plan to DIFE dated on 06.01.19. 24.09.2020: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 28.01.21 Visit observation: The consultant firm of the factory is EQMS. The firm did not submitted the correction design drawing after 16.04.19. 03.06.2021 visit observation: Consulting firm review correction design and drawing has not submitted yet. 22/08/2022: DEA report should be prepared and resubmitted to DIFE as soon a possible. 02/4/2023: Factory have lost track of their DEA work. they are preparing to restart the DEA work. Verbally they have stated that they are willing to do the DEA work as soon as possible.

১.২. কাৰ্যক্ৰম Building Engineer to survey as constructed building and prepare constructed layout and কাৰ্যক্ৰম elevation accordingly. সুপারিশের ভ৾খ্যসূত্র কার্থানার All drawings will be prepared by the Engineer. অগ্রাধিকার চুডান্ড २१-०७-२०५१ *স*মশ্বসীমা সংশোধিত সমশ্বসীমা অগ্রগতির অবস্থা 24.09.2020: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 28.01.21 Visit observation: Task force meeting held on 16.04.2019 consulting firm review correction design and drawing has not submitted yet. 03.06.2021 visit observation: Consulting firm review correction design and drawing has not মন্তব্য submitted yet. 22/08/2022: DEA report should be prepared and resubmitted to DIFE as soon as possible. 02/4/2023: Factory have lost track of their DEA work. they are preparing to restart the DEA work. Verbally they have stated that they are willing to do the DEA work as soon as possible. সংযুক্তিসমূহ (২)

প্রিদর্শন Water ponding has been found in the roof top due to lack of proper drainage and slope প্রব্যেশ্ব in the roof. The source of water is due to rainfall. ক্যাপ আইটেম ক্যাভাগরি

ক্যাটাগরি			
	•		
২.১. কাৰ্শক্ৰম			
কাৰ্শক্ৰম	Proper slope should be maintained on the roof top. Also engineer to inspect whether waterproofing material is applied or where it can be maintained. For both durability and serviceability, waterproofing on the roof slab is recommended.		
সুপারিশের তখ্যসূত্র			
কার্যথানার কার্যক্রম			
অগ্রাধিকার	প্রযোগ্য নয়		
চূড়ান্ত সময়সীমা	_		
সংশোধিত সময়সীমা	07-07-7940		
অগ্রগতির অবস্থা	সংশোধিত		
মন্তব্য	24.09.2020: In roof top has proper drainage system. There is no water ponding. 28.01.21 Visit observation: Water ponding has not been found on visit date. The factory management repairs this issue. 03.06.2021 visit observation: No water ponding found in visit day, there has proper drainage system. 22/08/2022: No Water ponding was found on roof top and found proper drainage and slope on roof during inspection date. 02-04-2023: Completed.		
সংযুক্তিসমূহ (8)			