



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখালা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখালার নাম	জাফর এলাই প্রাইজেস (প্রাঃ) লিঃ
ঠিকানা	Samad Super Market (3rd floor), 123/1/A, South Jatrabari, Dhaka
কারখালার কোড	DHK644
কালার কোড	

মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন	পর্যবেক্ষণের তারিখ: —
--	---------------------------------------

১. পর্যবেক্ষণ	<p>পরিদর্শন পর্যবেক্ষণ</p> <p>ক্যাপ আইটেম ক্যাটাগরি</p> <ul style="list-style-type: none"> □ Inadequate ventilation of the generator room □ The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No earth fault protection provided □ No cover on the cable trench
---------------	---

১.১. কার্যক্রম	<p>কার্যক্রম</p> <p>মুপারিষের তথ্যসূত্র</p> <p>কারখালার কার্যক্রম</p> <p>অধার্থকার</p> <p>চূড়ান্ত সময়সীমা</p> <p>সংশোধিত সময়সীমা</p> <p>অগ্রগতির অবস্থা</p> <p>মন্তব্য</p>	<ul style="list-style-type: none"> □ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. □ Provide firefighting equipment as required by the Guidelines. □ Provide earth fault protection <p># We will do the work done within mention time line.</p> <p>প্রযোজ্য লেখ</p> <p>১০-০৯-১৯০০</p> <p>০৯-০৯-১৯৭০</p> <p>সংশোধিত</p> <p>30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. 14-09-2021 Visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage.</p>
----------------	---	--

২. পর্যবেক্ষণ

পর্যবেক্ষণ পর্যবেক্ষণ	□ Inadequate ventilation of the generator room □ The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No earth fault protection provided □ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	□ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room □ Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখনার কার্যক্রম	# We will installation complite the fire door within mention time line. # We will Install the appropriate detectors.
অঞ্চলিকার	৬ গ্যাস
চূড়ান্ত সময়সীমা	২৯-০৯-১৯০০
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অঞ্চলিক অবস্থা	সংশোধিত
মন্তব্য	30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 14-09-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage.

৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Inadequate ventilation of the generator room □ The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No earth fault protection provided □ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	□ Remove Combustible materials from generator room. □ Ensure ventilation to generator □ Ensure double earthing of generator frame □ Provide cover on the cable trench
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	# We will provide adequate vantilationon the generator room. # We will provide adequate earthing connection soon. # We will provide adequate cover the cable trench.
অগ্রাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১০-০৬-২০১৬
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation:No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 14-09-2021 Visit Observation:No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage.

৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB installed on the wooden board
ক্যাপ আইটেম ক্যাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	□ Repair broken/loose MCCB/MCB box. □ Provide earthing to body & door. □ Provide clear identification mark on distribution board. □ Install MDB/SDB/SB or MCB on metal board.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	#We will properly grounded the panel boards soon. #We will provide first aid box and artificial respiration soon. # we will provide clear identification mark on distribution boards.
অঞ্চাকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১১-১০-২০১৬
সংশোধিত সময়সীমা	১৬-০৮-২০২২
অঞ্চাকার অবস্থা	গুরু হয়নি
মন্তব্য	30-09-2020 visit Observation: No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MDB installed on the wooden board On 15/12/2020: No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MCB/MCCB installed on the wooden board 24-05-2021 Visit Observation: No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MDB installed on the wooden board 14-09-2021 Visit Observation: No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MDB installed on the wooden board

৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB installed on the wooden board
ক্যাপ আইটেম ক্যাটাগরি	

৫.১. কার্যক্রম

কার্যক্রম	□ Provide instructions for first aid from exposure to electrical shock □ Ensure well-dressed cabling with lugs
মুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	#We will provide first aid box and artificial respiration soon. #We will do the work done within mention time line.
অংগীকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১০-০৬-২০১৬
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অংগতির অবস্থা	চলচাল
মন্তব্য	30-09-2020 visit Observation: No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MDB installed on the wooden board On 15/12/2020: cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MCB/MCCB installed on the wooden board. 24-05-2021 Visit Observation:cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MCB/MCCB installed on the wooden board. 14-09-2021 Visit Observation:cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock. Messy wire inside the DB. Body & door not earthed. No clear identification mark on distribution board. MCB/MCCB installed on the wooden board.

৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Electric cables do not pass through service shaft or insulated conduits Connections without lug Messy wiring Cable ends not properly soldered or crimped
কাপ আইটেম ক্যাটাগরি	

৬.১. কার্যক্রম

কার্যক্রম	Provide service ducts or insulated conduits Ensure secured connections with lug Replace messy wiring. Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কান্সালার কার্যক্রম	# We will provide service ducts soon. # We will use appropriate use cable socket.
অধ্যাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১১-১০-২০১৬
সংশ্লাভিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হবানি
মন্তব্য	30-09-2020 visit Observation: Electric cables do not pass through service shaft or insulated conduits. Cable ends not properly soldered or crimped. On 15/12/2020: Electric cables do not pass through service shaft or insulated conduits. Cable ends not properly soldered or crimped. 24-05-2021 Visit Observation: Electric cables do not pass through service shaft or insulated conduits. Cable ends not properly soldered or crimped. 14-09-2021 Visit Observation: Electric cables do not pass through service shaft or insulated conduits. Cable ends not properly soldered or crimped.