



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

শ্রমজীবী মানুষের অধিকার, বৈষম্যহীন
বাংলাদেশের অঙ্গীকার

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	জাকর এন্টার প্রাইভেট (প্রাঃ) লিঃ
ঠিকানা	Samad Super Market (3rd floor), 123/1/A, South Jatrabari, Dhaka
কারখানার কোড	DHK644
কালার কোড	

মূল্যায়নের ধরণ: <u>বৈদ্যুতিক মূল্যায়ন</u>	পর্যবেক্ষণের তারিখ: -
---	-----------------------

১. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Inadequate ventilation of the generator room <input type="checkbox"/> The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door <input type="checkbox"/> No detector in generator room <input type="checkbox"/> No firefighting equipment is present in the generator room <input type="checkbox"/> Combustible materials inside generator room <input type="checkbox"/> One point frame earthing of generator instead of two <input type="checkbox"/> No earth fault protection provided <input type="checkbox"/> No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. <input type="checkbox"/> Provide firefighting equipment as required by the Guidelines. <input type="checkbox"/> Provide earth fault protection
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	# We will do the work done within mention time line.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১০-০১-১৯০০
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. 14-09-2021 Visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage.

২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Inadequate ventilation of the generator room <input type="checkbox"/> The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door <input type="checkbox"/> No detector in generator room <input type="checkbox"/> No firefighting equipment is present in the generator room <input type="checkbox"/> Combustible materials inside generator room <input type="checkbox"/> One point frame earthing of generator instead of two <input type="checkbox"/> No earth fault protection provided <input type="checkbox"/> No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room <input type="checkbox"/> Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	# We will installation complete the fire door within mention time line. # We will Install the appropriate detectors.
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	২১-০১-১৯০০
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 14-09-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage.

৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<p>□ Inadequate ventilation of the generator room □ The generator room is not properly segregated from the rest of the occupancy due to presence of no Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No earth fault protection provided □ No cover on the cable trench</p>
ক্যাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	<p>□ Remove Combustible materials from generator room. □ Ensure ventilation to generator □ Ensure double earthing of generator frame □ Provide cover on the cable trench</p>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	<p># We will provide adequate ventilation on the generator room. # We will provide adequate earthing connection soon. # We will provide adequate cover the cable trench.</p>
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১০-০৬-২০১৬
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	<p>30-09-2020 visit Observation: During the visit, No generator was found. Factory management has informed that they are not using any generator for power outage. On 15/12/2020: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 24-05-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage. 14-09-2021 Visit Observation: No generator is found during visit. Factory management confirmed verbally they are not using any generator for power outage.</p>

৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB installed on the wooden board
কাপ আইটেম ক্যাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	□ Repair broken/loose MCCB/MCB box. □ Provide earthing to body & door. □ Provide clear identification mark on distribution board. □ Install MDB/SDB/SB or MCB on metal board.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	# We will properly grounded the panel boards soon. # We will provide first aid box and artificial respiration soon. # we will provide clear identification mark on distribution boards.
অগ্রাধিকার	প্রয়োজ্য নয়
চূড়ান্ত সময়সীমা	১১-১০-২০১৬
সংশোধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	30-09-2020 visit Observation: No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MDB installed on the wooden board On 15/12/2020: No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MCB/MCCB installed on the wooden board 24-05-2021 Visit Observation:No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MDB installed on the wooden board 14-09-2021 Visit Observation::No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MDB installed on the wooden board

৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB installed on the wooden board
ক্যাপ আইটেম ক্যাটাগরি	

৫.১. কার্যক্রম

কার্যক্রম	□ Provide instructions for first aid from exposure to electrical shock □ Ensure well-dressed cabling with lugs
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	#We will provide first aid box and artificial respiration soon. #We will do the work done within mention time line.
অগ্রাধিকার	প্রয়োজ্য নয়
চূড়ান্ত সময়সীমা	১০-০৬-২০১৬
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	30-09-2020 visit Observation: No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MDB installed on the wooden board On 15/12/2020: cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MCB/MCCB installed on the wooden board. 24-05-2021 Visit Observation:cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MCB/MCCB installed on the wooden board. 14-09-2021 Visit Observation:cables are securely connected with lugs but not well dressed. No instruction for first aid to electrical shock.Messy wire inside the DB.Body & door not earthed.No clear identification mark on distribution board.MCB/MCCB installed on the wooden board.

৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	☐ Electric cables do not pass through service shaft or insulated conduits ☐ Connections without lug ☐ Messy wiring ☐ Cable ends not properly soldered or crimped
কাপ আইটেম ক্যাটাগরি	

৬.১. কার্যক্রম

কার্যক্রম	☐☐ Provide service ducts or insulated conduits ☐ Ensure secured connections with lug ☐ Replace messy wiring. ☐ Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	# We will provide service ducts soon. # We will use appropriate use cable socket.
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	১১-১০-২০১৬
সংশোধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	30-09-2020 visit Observation: Electric cables do not pass through service shaft or insulated conduits.Cable ends not properly soldered or crimped. On 15/12/2020: Electric cables do not pass through service shaft or insulated conduits.Cable ends not properly soldered or crimped. 24-05-2021 Visit Observation:Electric cables do not pass through service shaft or insulated conduits.Cable ends not properly soldered or crimped. 14-09-2021 Visit Observation:Electric cables do not pass through service shaft or insulated conduits.Cable ends not properly soldered or crimped.