



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার  
শ্রম ও কর্মসংস্থান মন্ত্রণালয়  
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুঁঝকা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	ক্যাশল পয়েন্ট লিঃ
ঠিকানা	Plot#41-42, BSCIC I/E, Konabari, Gazipur
কারখানার কোড	GZP119
কালার কোড	

মূল্যায়নের ধরণ: **বৈদ্যুতিক মূল্যায়ন**      পর্যবেক্ষণের তারিখ: **২৭-০২-২০২৩**

**১. পর্যবেক্ষণ**

পরিদর্শন পর্যবেক্ষণ	Electrical cables do not run through separate service ducts Not sealed with noncombustible material at each floor level for electrical services duct
ক্যাপ আইটেম ক্যাটাগরি	

**১.১. কার্যক্রম**

কার্যক্রম	Provide service duct for electrical cables. Ensure prevention of fire and smoke propagation through vertical shafts by providing fire rated enclosures around the openings along with seals in shafts and ducts at floor separations.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
ঐতাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতিৰ অবস্থা	চলগাল
মন্তব্য	08-10-2020 (CVV-1): 1. Electrical cables do not run through separate service ducts. 2. Cables penetrations through wall is not adequately covered and sealed with fire resistive elements. 19.01.2021: Electrical cables do not run through separate service ducts. 11-04-2021 (CVV-3): 1. Electrical cables do not run through separate Service ducts. 2. Cables penetration through wall are adequately covered and sealed. 22-08-2021 (CVV-4): 1. Electrical cables do not run through separate service ducts. 2. Cables penetrations through wall is not adequately covered and sealed with fire resistive elements. 17-08-2022 visit observation: 1. Electrical cables do not run through separate service ducts. 2. Cables penetrations through wall is not adequately covered and sealed with fire resistive elements. 27-02-2023 visit observation: 1. Electrical cables do not run through separate service ducts. 2. Cables penetrations through wall is not adequately covered and sealed with fire resistive elements.

**সংযুক্তিমূহ ( ৮ )**



## ২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Naked lights in storage
ক্যাপ আইটেম ক্যাটগরি	

### ২.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide cover on naked light.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অধার্থিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	08-10-2020 (CVV-1): Covered light fixtures (LED Light) are installed inside the storage area. 19.01.2021: Light fixtures are covered. 11-04-2021 (CVV-3): Covered light fixtures (LED Light) are installed inside the storage area. 22-08-2021 (CVV-4): Light fixtures are covered were found. 17-08-2022 visit observation: Covered light fixtures (LED Light) were found inside the storage area. 27-02-2023 visit observation: Covered light fixtures (LED Light) were found inside the storage area.
সংযুক্তসমূহ (২)	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

## ৩. পর্যবেক্ষণ

পর্যবেক্ষণ পর্যবেক্ষণ	□ Combustible/junk materials inside generator room.
কাপ আইটেম ক্যাটাগরি	

### ৩.১. কার্যক্রম

কার্যক্রম	□ Remove combustible materials from generator room. □ Ensure accessibility and ventilation to generator □ Ensure double earthing of generator frame □ Provide cover on the cable trench
মুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অঞ্চলিক অবস্থা	সংশোধিত
মন্তব্য	08-10-2020 (CVV-1): 1. The generator room is clean and free of dirt, debris and improperly stored materials. 2. The Generator room is adequately ventilated. 3. Generator frame earthing (grounding) is provided at two separate points. 4. There is no cable trench in the factory. 19.01.2021: Combustible/junk materials inside generator room has been removed. 11-04-2021 (CVV-3): 1. The generator room is clean and free of dirt, debris and improperly stored materials. 2. The Generator room is adequately ventilated. 3. Generator frame earthing (grounding) is provided at two separate points. 4. There is no cable trench in the factory. 22-08-2021 (CVV-4): 1. The generator room is clean and free of dirt, debris and improperly stored materials. 2. The Generator room is adequately ventilated. 3. Generator frame earthing (grounding) is provided at two separate points. 4. There is no cable trench in the factory. 17-08-2022 visit observation: 1. The generator room were found clean and free of dirt, debris. 2. The Generator room is adequately ventilated. 3. Generator frame earthing (grounding) is provided at two separate points. 4. No combustible materials were found in the generator room. 5. There is no cable trench in the factory. 27-02-2023 visit observation: 1. The generator room were found clean and free of dirt, debris. 2. The Generator room is adequately ventilated. 3. Generator frame earthing (grounding) is provided at two separate points. 4. No combustible materials were found in the generator room. 5. There is no cable trench in the factory.
সংযুক্তিমূহ ( 8 )	<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>

### ৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<p>No SLD/clear identification mark for MDB/DB/SDB □ Access obstructed/barred □ Visible burn marks □ Panel door damaged □ DB body and door not earthed □ No or empty earth bar □ Motor body not earthed □ Undressed messy wire inside □ Connections without lug □ Loose or broken socket □ MDB does not have duplicate earth leads</p>
ক্যাপ আইটেম ক্যাটাগরি	

### ৪.১. কার্যক্রম

কার্যক্রম	□ Provide clear identification mark on MDB/DB/SDB and provide SLD □ Find cause of burning inside DBs and take appropriate actions □ Install/repair panel door as appropriate. □ Provide earthing to body and door of MDB/DB/SDB. □ Provide earth bar in MDB/DB/SDB □ Provide earthing to motor body. □ Replace undressed messy wiring/cables □ Ensure all connection with lugs and proper cable dressing □ Repair broken/loose socket □ Provide duplicate earth leads for MDB.
মুপারিষেব তথ্যসূত্র	
কারখানার কার্যক্রম	
অঞ্চালিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	08-10-2020 ( CVV-1 ) : 1. No clear and permanent identification marking of distribution board is found and SLD is not posted on Distribution Board. 2. Distribution Boards are installed at compliant location. 3. Burning sign is not observed inside the Distribution Boards. 4. Damaged panel door is repaired. 5. Distribution Board including panel door is earthed. 6. Earth bus bars are installed in panel boards. 7. Electrical equipment ( motor, machines ) are efficiently earthed. 8. Undressed messy wire is not present inside the Distribution Boards. 9. Cable lugs are not provided for stranded conductors at MCB terminals. 10. Removed faulty socket and replaced with good one. 11. Duplicate earth leads are not provided for MDB. 19.01.2021: 11-04-2021 ( CVV-3 ) : 1. No clear and permanent identification marking of distribution board is found and SLD is not posted on Distribution Board. 2. Distribution Boards are installed at compliant location. 3. Burning sign is not observed inside the Distribution Boards. 4. Damaged panel door is repaired. 5. Distribution Board including panel door is earthed. 6. Earth bus bars are installed in panel boards. 7. Electrical equipment ( motor, machines ) are efficiently earthed. 8. Undressed messy wire is not present inside the Distribution Boards. 9. Cable lugs are not provided for stranded conductors at MCB terminals. 10. Removed faulty socket and replaced with good one. 11. Duplicate earth leads are not provided for MDB. 22.08.2021( CVV-4 ) : 1. No clear and permanent identification marking was available. 2. Distribution Boards are installed at compliant location. 3. Burning sign is not observed. 4. Damaged panel door is repaired. 5. Distribution Board including panel door is earthed. 6. Earth bus bars was not available inside some DB. 7. Electrical equipment ( motor, machines ) are not efficiently earthed. 8. Undressed messy wire was available inside DB. 9. Cable lugs are not. 10. Removed faulty socket and replaced with good one. 11. Duplicate earth leads are not provided for MDB. 17-08-2022 visit observation: 1. No clear and permanent identification marking were found. 2. Distribution Boards were installed at compliant location. 3. Burning sign was not observed. 4. Damaged panel door was not found. 5. Distribution Board including panel door were not earthed properly. 6. Earth bus bars was not available inside some Distribution Board. 7. Electrical equipment ( motor, machines ) are not efficiently earthed. 8. Undressed messy wire were not found inside Distribution Board. 9. Proper cable lugs were not used in some Distribution Board. 10. Removed faulty socket and replaced with good one. 11. Duplicate earth leads were not provided for MDB. 27-02-2023 visit observation: 1. No clear and permanent identification marking were found. 2. Distribution Boards were installed at compliant location. 3. Burning sign was not observed. 4. Damaged panel door was not found. 5. Distribution Board including panel door were earthed properly. 6. Earth bus bars was available inside Distribution Board. 7. Electrical equipment ( motor, machines ) are efficiently earthed. 8. Undressed messy wire were not found inside Distribution Board. 9. Proper cable lugs were used in some Distribution Board. 10. Removed faulty socket and replaced with good one. 11. Duplicate earth leads were provided for MDB.

## সংযুক্তিসমূহ ( ৬ )



## ৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Undressed and messy wiring/cables
ক্যাপ আইটেম ক্যাটগরি	

### ৫.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Replace undressed messy wiring/cables
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অধার্থিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	সংশোধিত
মন্তব্য	08-10-2020 (CVV-2): Undressed messy wire is not present inside the Distribution Boards 19.01.2021: Undressed and messy wiring/cables was available. 11-04-2021 (CVV-3): Undressed messy wire are not present inside the Distribution Boards. 22.08.2021 (CVV-4): Undressed and messy wiring/cables was available. 17-08-2022 visit observation: Undressed and messy wiring were not found. 27-02-2023 visit observation: Undressed and messy wiring were not found.
সংযুক্তসমূহ (২)	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	

## ৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Lightning protection system not available
কাপ আইটেম ক্যাটাগরি	

#### ৬.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide appropriate Lightning protection system. <input type="checkbox"/> Provide air termination network
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	
অধার্থিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	চলচাল
মন্তব্য	08-10-2020 ( CVV-1 ) : Lightning Protection System ( LPS ) is not installed on the factory building. but Proposed lighting protection system approved by DIFE . 19.01.2021: LPS was not installed but design drawing has been approved. 11-04-2021 ( CVV-3 ) : Lightning protection system is not installed but design drawing has been approved. 22-08-2021 ( CVV-4 ) : lightning protection system is not installed but design drawing has been approved. 17-08-2022 visit observation: Approved Lightning Protection System ( LPS ) drawing has been found but factory not yet installed LPS system. 27-02-2023 visit observation: Approved Lightning Protection System ( LPS ) drawing has been found but factory not yet installed LPS system.
সংযুক্তিসমূহ ( 8 )	
<input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/> <input checked="" type="checkbox"/>	