

# গণপ্রজাতন্ত্রী বাংলাদেশ সরকার

শ্রম ও কর্মসংস্থান মন্ত্রণাল্য কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

# ক্যাপ পর্ববেষ্ফণের তথ্য

	এস আই নিটিং লি:
ঠিকানা	26/1, Shataish Road, Tongi, Gazipur
কারখানার কোড	<b>GZP</b> 292
কালার কোড	

নুল্যায়নের ধর	: বৈঘুত্তিক মূল্যায়ন	পর্যবেষ্কণের তারিখ:	₹ <b>७</b> −०১−₹०₹।
. পৰ্যবেষ্ফণ	<u> </u>		
17(420)	Electrical cables do not run through	separate Service ducts	
ক্যাপ আইটেম ক্যাটাগরি			
১.১. কাৰ্যক্ৰ	1		
কাৰ্যক্ৰম		ke propagation through vertical shafts nd the openings along with seals in she service duct for electrical cables	
সুপারিশের তখ্যসূত্র	·		
কার্থানার কার্যক্রম	we will do as per guideline within the	ne mentioned timeline.	
1	প্র্যোগ্য ন্য		
চুডান্ড সময়সীমা	22-06-5029		
সংশোধিত সময়সীমা	07-07-7940		
অগ্রগতির অবস্থা	শুৰু হ্য়নি		
মন্তব্য	On 26-01-2021 (CVV-2): Electrical ducts and it is in critical condition. On the condition of run through separate Service do On 23-08-2021 (CVV-4): Electrical ducts and it was in same condition	bles do not run through separate Serv I cables do not run through separate SOn 03-05-2021 (CVV-3): Electrical caucts and it was in same condition as profice as previous. 01-09-2022 visit observations separate service ducts. 23-01-2023:	Service ables do revious. Service ation:
সংযুক্তি × ×	সমূহ (8) 🗷 🗷		

পরিদর্শন পর্ববেষ্কণ	The generator room is not properly segregated from the rest of the occupancy The generator room smaller than the required size Combustible material inside No over-current protection provided No earth-fault protection
ক্যাপ আইটেম ক্যাটাগরি	

১. কাৰ্যক্ৰ	
কাৰ্যক্ৰম	☐ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. ☐ Provide over current and earth fault protection
সুপারিশের তথ্যসূত্র	
কার্যথানার কার্যক্রম	we will provide design drawing according to guideline.
	প্রশোজ্য লয়
চুডান্ড সমশ্বসীমা	58-75-507 <i>P</i>
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্ৰানি
<b>মন্ত</b> ব্য	08–10–2020 (CVV-1):  The generator room is not properly segregated from the rest of the occupancy No over–current protection provided No earth–fault protection 26–01–2021 (CVV-2): # The generator room is not properly segregated from the rest of the occupancy # No over–current protection provided # No earth–fault protection 03–05–2021 (CVV-3): It was in same condition as previous # The generator room is not properly segregated from the rest of the occupancy # No over–current protection provided # No earth–fault protection 23–08–2021 (CVV-4): It was in same condition as previous. i) The generator room is not properly segregated from the rest of the occupancy ii) No over–current protection provided iii) No earth–fault protection 01–09–2022 visit observation: 1.The generator room was not properly segregated from the rest of the occupancy 2.No over–current & earth–fault protection were provided 23–01–2023: Same as previous visit.

#### ৩. পর্ববেষ্ফণ

পরিদর্শন পর্ববেষ্কণ	$\square$ The generator room is not properly segregated from the rest of the occupancy $\square$ The generator room smaller than the required size $\square$ Combustible material inside $\square$ No over-current protection provided $\square$ No earth-fault protection
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্যক্ৰম	$\square$ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room $\square$ Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কারখানার কার্বজ্ঞম	We will install fire door according to guideline.
	প্রব্যোগ্য নর
চুডান্ত সমশ্বসীমা	27-08-3099
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হৰ্মনি
মন্তব্য	08–10–2020 (CVV-1): Provide fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room Install appropriate detectors. 26–01–2021 (CVV-2): # Fire rated enclosure from floor to ceiling and fire rated self-closing swing door for the generator was not provided. # Appropriate detectors was not installed. 03–05–2021 (CVV-3): It was in same condition as previous. # Fire rated enclosure from floor to ceiling and fire rated self-closing swing door for the generator was not provided. # Appropriate detectors was not installed. 23–08–2021 (CVV-4): It was in same condition as previous. i) Fire rated enclosure from floor to ceiling and fire rated self-closing swing door for the generator was not provided. ii) Appropriate detectors was not installed. 01–09–2022 visit observation: 1. Fire rated enclosure from floor to ceiling and fire rated self-closing swing door for the generator were not provided. 2. Appropriate detectors were not installed. 23–01–2023: Same as previous visit.

# ৪. পর্যবেষ্ণণ

পরিদর্শন পর্শবেষ্ডণ	$\Box$ The generator room is not properly segregated from the rest of the occupancy $\Box$ The generator room smaller than the required size $\Box$ Combustible material inside $\Box$ No over-current protection provided $\Box$ No earth-fault protection
ক্যাপ আইটেম ক্যাটাগরি	

কাৰ্যক্ৰম	Remove Combustible materials from generator room. Ensure accessibility and
	ventilation to generator   Ensure double earthing of generator frame
সুপারিশের তথ্যসূত্র	
কার্থানার কার্বক্রম	Aiready we have done.
	প্রযোগ্য নর
চুডান্ড সময়সীমা	_
সংশোধিত সময়সীমা	07-07-7940
অগ্রগতির অবস্থা	শুৰু হ্ৰনি
<b>মন্ত</b> ব্য	O8–10–2020 (CVV–1): Remove Combustible materials from generator room. Ensure accessibility and ventilation to generator Ensure double earthing of generator frame 26–01–2021 (CVV–2): # Combustible materials were found inside generator room. # Accessibility and ventilation to generator room was not provided. # No body earthing was provided to generator. O3–05–2021 (CVV–3): It was in same condition as previous # Combustible materials were found inside generator room. # Accessibility and ventilation to generator room was not provided. # No body earthing was provided to generator. 23–08–2021 (CVV–4): It was in same condition as previous i) Combustible materials were found inside generator room. ii) Accessibility and ventilation to generator room was not provided. iii) No body earthing was provided to generator. O1–09–2022 visit observation: 1.Combustible materials were found inside generator room. 2.Accessibility and ventilation to generator room were not provided. 3.Double earthing of generator frame were not provided. 23–01–2023: Same as previous visit.

# ধ. পর্যবেষ্ণ

পরিদর্শন পর্ববেষ্ফণ	$\square$ Substation located on higher floor $\square$ Access limited/barred $\square$ Connection without lug $\square$ Partition wall not extended up to the ceiling $\square$ Panel body $\&$ door not earthed $\square$ Electric cables do not pass through service shaft or insulated conduits
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্ৰম	•
.ऽ. भानक	
কাৰ্যক্ৰম	Provide easy access to the substation Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Substation room. Ensure earthing of panel body & door with fitted condition.
সুপারিশের তখ্যসূত্র	
কার্য্থানার কার্যক্রম	We will provide design drawing according to guideline.
অগ্রাধিকার	প্রযোগ্য নয়
চুডান্ত সময়সীমা	28-32-2036
সংশোধিত সমর্মীমা	07-07-7940
অগ্রগতির অবস্থা	চলমান
	Substation   Sub
সংখ্যুক্ত ×	মৃহ (৬) × × ×

পরিদর্শন পর্ববেষ্কণ	Substation located on higher floor Access limited/barred Connection without lug Partition wall not extended up to the ceiling Panel body & door not earthed Electric cables do not pass through service shaft or insulated conduits
ক্যাপ আইটেম ক্যাটাগরি	

.১. কাৰ্যক্ৰম	
_	
কাৰ্যক্ৰম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Substation room. Place substation in ground floor Install appropriate detectors
সুপারিশের তখ্যসূত্র	
কার্থানার কার্বক্রম	We will do as per guideline within the mentioned timeline.
অগ্রাধিকার	প্রযোগ্য নর
거워작게테	25-08-5070
मभग्रमाभा	07-07-790
অগ্রগতির অবস্থা	চলমান
<b>মন্ত</b> ব্য	08–10–2020 (CVV-1): Provide fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Substation room. Place substation in ground floor Install appropriate detectors. 26–01–2021 (CVV-2): # Substation installed at ground floor. # Substation room was not fire rated and fire door was not installed. 03–05–2021 (CVV-3): It was in same condition as previous. # Substation installed at ground floor. # Substation room was not fire rated and fire door was not installed. 23–08–2021 (CVV-4): It was in same condition as previous. i) Substation installed at ground floor. ii) Substation room was not fire rated and fire door was not installed. 01–09–2022 visit observation: 1. Substation was installed at ground floor. 2. Substation room were not fire rated and fire door were not installed. 3. Appropriate detectors were not installed. 23–01–2023: Same as previous visit.
	নমূহ (৪) <b>×</b> ×

#### ৭. পর্ববেষ্ফণ

পরিদর্শন পর

#### ৭.১. কার্যক্রম $oxedsymbol{\parallel}$ Remove combustible materials from substation. $oxedsymbol{\parallel}$ Ensure accessibility and ventilation to substation | Provide instructions for first aid and artificial respiration কাৰ্যক্ৰম from exposure to electrical shock. Provide cover on the cable trench and rubber mat in front of the panel lacksquare Ensure well-dressed cabling with lugs সুপারিশের ত্থ্যসূত্র কারখানার We will provide first aid and artificial respiration soon. কাৰ্যক্ৰম **অগ্রাধিকার** প্রযোগ্য নয় চুড়ান্ত 08-50-2056 <u> नेभेश्र</u>नीभा সংশোধিত 05-05-5590 সময়সীমা অগ্রগতির চলমান অবস্থা 08-10-2020 (CVV-1): Remove combustible materials from substation. accessibility and ventilation to substation [] Provide instructions for first aid and artificial respiration from exposure to electrical shock. Provide cover on the cable trench and rubber mat in front of the panel. $\square$ Ensure well-dressed cabling with lugs 26-01-2021(CVV-2): # Combustible materials was not found at substation room # Accessibility and ventilation to substation was not provided. # Instruction for First aid and artificial respiration was not found at substation room. # Cable trench and Rubber mat was not provided in front of DB. # Cable dressing was not provided appropriately. 03-05-2021 (CVV-3): It was in same condition as previous. # Combustible materials was not found at substation room. # Accessibility and ventilation to substation was not provided. # Instruction for First মন্তব্য aid and artificial respiration was not found at substation room. On 23-08-2021 (CVV-4): It was in same condition as previous. i) Combustible materials was not found at substation room. ii )Accessibility and ventilation to substation was not provided. iii) Instruction for First aid and artificial respiration was not found at substation room. iv ) Cable trench and Rubber mat was not provided in front of DB. v) Cable dressing was not provided appropriately. 01-09-2022 visit observation: 1. Combustible materials was not found at substation room 2. Accessibility and ventilation to substation were not provided. 3.Instruction for First aid and artificial respiration were not found at substation room. 4. Cable trench and Rubber mat were not provided in front of DB. 5. Cable dressing was not provided appropriately. 23-01-2023: Same as previous visit. সংশুক্তিসমূহ (৮) x x x x x x

পর্ববেষ্কণ	No instruction for first aid to electrical shock Access obstructed/barred Connection without lug Undressed messy wire inside Body & door not earthed Installed on wooden board MCCB/MCB box broken/loose Does not have duplicate earth leads
ক্যাপ আইটেম ক্যাটাগরি	

ורוויוטוני	
1 3110	
১. কাৰ্যক্ৰম	
কাৰ্শক্ৰম	Repair broken/loose MCCB/MCB box. Provide duplicate earth leads. Provide earthing to body & door. Identify cause of burning inside distribution box and take remedial measures Provide clear identification mark on distribution board. Install MDB/SDB/SB or MCB on metal board.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We have some distribution boards are grounded.
<u>অগ্রা</u> ধিকার	প্রযোগ্য নয়
চুড়ান্ড সমশ্বসীমা	<i>₹%−77−507®</i>
সংশোধিত সমশ্রসীমা	07-07-7940
অগ্রগতির অবস্থা	চলমাল
মন্তব্য	08-10-2020 (CVV-1): No instruction for first aid to electrical shock Access obstructed/barred Connection without lug Undressed messy wire inside Body door not earthed Installed on wooden board MCCB/MCB box broken/loose Does not have duplicate earth leads 26-01-2021 (CVV-2): #Connection without lug # Body & door not earthed # Installed on wooden board # MCCB/MCB box was not broken/loose # Does not have duplicate earth leads 03-05-2021 (CVV-3): It was in same condition as previous. #Connection without lug # Body & door not earthed # Installed on wooden board # MCCB/MCB box was not broken/loose # Does not have duplicate earth leads 23-08-2021 (CVV-4): It was in same condition as previous. i) Connection without lug ii) Body & door not earthed iii) Installed on wooden board iv) MCCB/MCB box was not broken/loose v) Does not have duplicate earth leads 01-09-2022 visit observation: 1.Panel board were not install properly. 2.Duplicate earth leads were not provided in MDB. 3.Body & door earthing were found in distribution boards. 4.No visible burn were observed. 5.Clear identification mark on distribution board were not found. 6.MDB/SDB/SB or MCB were installed on metal board. 23-01-2023: Same as previous visit.
সংযুক্তি	মমূহ (৮)
×	x x x x x

# ১. পর্ববেষ্ণণ

No instruction for first aid to electrical shock Access obstructed/barred প্রদর্শন Connection without lug Undressed messy wire inside Body & door not earthed Installed on wooden board MCCB/MCB box broken/loose Does not have duplicate earth leads
ক্যাপ
আইটেম
ক্যাটাগরি

#### ৯.১. কাৰ্যক্ৰম lacksquare Provide instructions for first aid from exposure to electrical shock lacksquare Remove obstruction to ensure access to MDB/MCCB Box [] Ensure well-dressed cabling কাৰ্যক্ৰম with lugs সুপারিশের ত্থ্যসূত্র কাৰ্থানাৰ We will provide first aid and artificial respiration soon. Sockets are provided for কাৰ্যক্ৰম some cables. **অগ্রাধিকার** প্রযোগ্য নয় চুডান্ড 08-50-2056 সময়সীমা সংশোধিত 05-05-5590 সময়সীমা অগ্রগতির চলমান অবস্থা 08-10-2020 (CVV-1): No instruction for first aid to electrical shock Access obstructed/barred [] Connection without lug [] Undressed messy wire inside [] Body & door not earthed $flacked{1}$ Installed on wooden board $flacked{1}$ MCCB/MCB box broken/loose $flacked{1}$ Does not have duplicate earth leads 26-01-2021 (CVV-2): # No instruction for first aid to electrical shock # Access obstructed/barred # Undressed messy wire inside 03-05-2021 (CVV-3): It was in same condition as previous # No instruction for first aid to electrical shock # Access obstructed/barred # Undressed মন্তব্য messy wire inside 23-08-2021 (CVV-4): It was in same condition as previous i) No instruction for first aid to electrical shock ii ) Access obstructed/barred iii ) Undressed messy wire inside 01-09-2022 visit observation: 1.Instructions for first aid from exposure to electrical shock were not provided at required location. 2. Panel board were found easy accessible. 3. Un-dressed cabling without lugs were found. 23-01-2023: Same as previous visit. সংযুক্তিসমূহ (৬) x x x x x

#### ১০. পর্যবেষ্ণণ

পরিদর্শন পর্শবেষ্ড৹	Electric cables do not pass through service shaft or insulated conduits Connection without lug Undressed messy wire inside
ক্যাপ আইটেম ক্যাটাগরি	į

ি Provide service ducts or insulated conduits lensure secured connections with lug Replace undressed messy wiring/cables মুগানিশের ভাগুর কার্থানার কার্থক্স আমিকার ব্যালার কার্থক্স আমাকার ত ১০০১৯৯৭০  কার্থমানার ত ১০০১৯৯৭০  কার্যমানার ত ১০০১৯৭০  কার্যমানার ত ১০০১৯৪৭০  কার্যমানার ত ১০০১৪৪০০  কার্যমানার ত ১০০১৯৪৭০  কার্যমানার কার কার্যমানার কার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার কার্যমানার কার্যমানার কার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার্যমানার কার কার	ী Replace undressed messy wiring/cables সুপারিশের ভখ্যসূত্র কারখানার কার্যক্তম আমিকার প্রযোজ্য নর  চুড়ান্ত সমরসীমা সংশোধিজ সমরসীমা অগ্রগতির অবস্থা  08-10-2020(CVV-1):    Electric cables do not pass through service insulated conduits    Connection without lug    Undressed messy w 01-2021(CVV-2): # Electric cables do not pass through service: conduits # Connection without lug # Undressed messy wire inside 2021(CVV-3): It was in same condition as previous. # Electric cathrough service shaft or insulated conduits # Connection without messy wire inside 23-08-2021 (CVV-4): It was in same condition Electric cables do not pass through service shaft or insulated conduits # Connection without messy wire inside 23-08-2021 (CVV-4): It was in same condition Electric cables do not pass through service shaft or insulated conduits # Connection without lug iii) Undressed messy wire inside 01-09-2	
্বি Replace undressed messy wiring/cables  মুগানিশের ভথ্যসূত্র কারশানার কার্যক্রম  বাবাজা লয়  ভূজন্ত মন্যসীমা  স্কার্যক্রম  তিলালি  তিলিলি  তিলিলি  তিলিলি  তিলিলি  তিলিলি	মুপানিশেন ভখ্যসূত্ৰ কাৰখানাৰ কাৰ্যক্ৰম আন্ত্ৰাধিকাৰ ত্ৰ্যাপ্তৰ ন্ত্ৰাহ্যক্ৰম আন্ত্ৰাধিকাৰ ত্ৰ্যাভাত্ত সম্বস্মীমা আন্ত্ৰাভিন অবস্থা তিন্ত্ৰাহ্যক্ৰম ত্ৰাহ্যক্ৰম ত্	
কাৰণানাৰ কাৰ্যক্তম আধিকাৰ প্ৰযোজ্য নথ চূড়ান্ত মূম্বৰ্যমা নাম্বেলামিন্ত মূম্বৰ্যমা বিশ্বন্ত কাৰ্যমামা নাম্বেলামিন্ত মূম্বৰ্যমা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমামা বিশ্বন্ত কাৰ্যমা বিশ্বন্ত কাৰ্যমা বিশ্বন্ত কাৰ্যমা বিশ্বন্ত কাৰ্যমামা বিশ্ব	কাৰ্থানাৰ কাৰ্ৰজন প্ৰযোজ্য লয়  তুজন্ত সমন্ত্ৰসীমা  সংশোধিত সমন্ত্ৰসীমা  অগ্ৰাতিৰ অৰ্থা  তিলমাল  তিলম	nections with lu
কাৰ্শনাৰ কৰ্ম Already we have done.  অগ্ৰাধিকাৰ প্ৰশ্বেজ্য ল্ব  চুড়ান্ত  সম্বাসীমা সংশোধিত  সম্বাসীমা অঞ্ৰাজিৰ  অবস্থা  08-10-2020(CVV-1): Electric cables do not pass through service shaft or insulated conduits Connection without lug Undressed messy wire inside 26-  01-2021(CVV-2): Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 03-05-  2021(CVV-3): It was in same condition as previous. # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 03-05-  2021(CVV-3): It was in same condition as previous. # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 01-09-2022 visit observation: 1.Service ducts or insulated conduits were not provided for passing electric cables. 2.Undressed messy wiring/cables were found. 3.Connection without lug were found. 23-01-2023: Electrical work is under process. Because	মান্ত্ৰ্যাদিকাৰ প্ৰযোজ্য লয়  তুজন্ত সমন্ত্ৰসীমা  সংশোধিত সমন্ত্ৰসীমা  তিল্যাল  তিল  তিল্যাল  তিল  তিল্যাল  তি	
চুড়ান্ত সমর্যীমা  মংশোধিত সমর্যীমা  অঞ্চাতির অবস্থা  08-10-2020(CVV-1):    Electric cables do not pass through service shaft or insulated conduits    Connection without lug    Undressed messy wire inside 26-01-2021(CVV-2): # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 03-05-2021(CVV-3): It was in same condition as previous. # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 23-08-2021 (CVV-4): It was in same condition as previous. i)  Electric cables do not pass through service shaft or insulated conduits ii)  Connection without lug iii) Undressed messy wire inside 01-09-2022 visit observation: 1.Service ducts or insulated conduits were not provided for passing electric cables. 2.Undressed messy wiring/cables were found. 3.Connection without lug were found. 23-01-2023: Electrical work is under process. Because	চুড়ান্ত সমরসীমা সংশোধিত সমরসীমা অগ্রগতির অবস্থা  08-10-2020(CVV-1): I Electric cables do not pass through servi insulated conduits I Connection without lug I Undressed messy w 01-2021(CVV-2): # Electric cables do not pass through service s conduits # Connection without lug # Undressed messy wire inside 2021(CVV-3): It was in same condition as previous. # Electric ca through service shaft or insulated conduits # Connection without messy wire inside 23-08-2021 (CVV-4): It was in same condition Electric cables do not pass through service shaft or insulated conduits Connection without lug iii) Undressed messy wire inside 01-09-2	
সমস্বাসীমা সংশাধিত সমস্বসীমা অঞ্চাতিব অবস্থা  তিলমাল	সাম্যা সংশাধিত সম্যা তিল্মান	
সমধ্যমি  াজ্যান্তিৰ জ্বান্ত্ৰ  তিল্যান্ত্ৰ	মন্ধ্যমীমা  অপ্রগতির অবস্থা  08-10-2020(CVV-1):	
ত8-10-2020(CVV-1): Electric cables do not pass through service shaft or insulated conduits Connection without lug Undressed messy wire inside 26-01-2021(CVV-2): # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 03-05-2021(CVV-3): It was in same condition as previous. # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 23-08-2021(CVV-4): It was in same condition as previous. i) Electric cables do not pass through service shaft or insulated conduits ii) Connection without lug iii) Undressed messy wire inside 01-09-2022 visit observation: 1. Service ducts or insulated conduits were not provided for passing electric cables. 2. Undressed messy wiring/cables were found. 3. Connection without lug were found. 23-01-2023: Electrical work is under process. Because	ত্তিশ্বাল তিলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্স তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্ষাল তেলেক্য	
insulated conduits [] Connection without lug [] Undressed messy wire inside 26–01–2021(CVV-2): # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 03–05–2021(CVV-3): It was in same condition as previous. # Electric cables do not pass through service shaft or insulated conduits # Connection without lug # Undressed messy wire inside 23–08–2021 (CVV-4): It was in same condition as previous. i) Electric cables do not pass through service shaft or insulated conduits ii) Connection without lug iii) Undressed messy wire inside 01–09–2022 visit observation: 1.Service ducts or insulated conduits were not provided for passing electric cables. 2.Undressed messy wiring/cables were found. 3.Connection without lug were found. 23–01–2023: Electrical work is under process. Because	insulated conduits \( \text{Connection without lug } \text{Undressed messy w} \\ 01-2021(CVV-2): # Electric cables do not pass through service sonduits # Connection without lug # Undressed messy wire inside 2021(CVV-3): It was in same condition as previous. # Electric cathrough service shaft or insulated conduits # Connection without messy wire inside 23-08-2021 (CVV-4): It was in same condition Electric cables do not pass through service shaft or insulated conduction without lug iii) Undressed messy wire inside 01-09-2	
parey are merge with other most winch was not included with DEOTI.	electric cables. 2.Undressed messy wiring/cables were found. 3.C	re inside 26- haft or insulated 03-05- bles do not pass ug # Undressed n as previous. i) uits ii) 022 visit ed for passing onnection ess. Because

# ১১. পর্ববেষ্ফণ

পরিদর্শন পর্ববেষ্ফণ	Lightning protection system not available
ক্যাপ	
পাহ(৬৸   ক্যাটাগরি	

# ১১.১. কার্শক্রম কার্শক্রম Provide appropriate Lightning protection system. সুপারিশের

কার্থানার কার্যক্রম We will install lightning protection system soon.

**অগ্রাধিকার** প্রযোগ্য নয় **চডান্ড** 

ত্তখ্যসূত্র

সংশোধিত ১-০১-১৯৭০ সময়সীমা

**অগ্রগতির** অবস্থা

মন্তব্য

08–10–2020 (CVV–1): Lightning protection system (LPS) design / drawing deed has been done according to the deed copy with the consultancy. 26–01–2021 (CVV–2): LPS was not installed yet and no design drawing copy was available during inspection. 03–05–2021 (CVV–3): It was in same condition as previous and LPS was not installed yet and no design drawing copy was available during inspection. On 23–08–2021 (CVV–4): It was in same condition as previous and LPS was not installed yet and no design drawing copy was available during inspection. 01–09–2022 visit observation: Lightning protection system (LPS) was not installed on top of the building. 23–01–2023: Lightning protection system (LPS) was not installed on top of the building but they have approved drawing.

সংযুক্তিসমূহ (৪) × × × ×