



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

শ্রমজীবী মানুষের অধিকার, বৈষম্যহীন
বাংলাদেশের অঙ্গীকার

ক্যাপ পর্যবেক্ষণের তথ্য

কারখানার নাম	ওয়েগা অ্যাপারেলস লিঃ
ঠিকানা	183, Senpara Parbata, Section # 10
কারখানার কোড	DHK628
কালার কোড	
মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন	পর্যবেক্ষণের তারিখ: -
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> □ The generator room smaller than the required size □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> □ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. □ Provide firefighting equipment as required by the Guidelines. □ Provide over current and earth fault protection
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	<p>On 29.09.2020: > The generator room is smaller than requirement in size. > There's no fire separation between the generator and the rest of the occupancy. > there's no detector in generator room. > No firefighting equipmnet was available in the generator room. > Combustible materials were present inside the generator room. > Double earthing was not ensured on the generator body. > Over current protection device was present but no earth fault protection was found. > No cover was found on the cable trench. > Factory has not produced fire separation design drawings yet. > Firefighting equipment has not been provided in the generator room. On 11.01.2021: > The generator room is smaller than requirement in size. > There's no fire separation between the generator and the rest of the occupancy. > there's no detector in generator room. > No firefighting equipmnet was available in the generator room. > Combustible materials were present inside the generator room. > Double earthing was not ensured on the generator body. > Over current protection device was present but no earth fault protection was found. > No cover was found on the cable trench. > Factory has not produced fire separation design drawings yet. > Firefighting equipment has not been provided in the generator room. On 13.09.2021: > The generator room is smaller than requirement in size. > There's no fire separation between the generator and the rest of the occupancy. > there's no detector in generator room. > No firefighting equipmnet was available in the generator room. > Combustible materials were present inside the generator room. > Double earthing was not ensured on the generator body. > Over current protection device was present but no earth fault protection was found. > No cover was found on the cable trench. > Factory has not produced fire separation design drawings yet. > Firefighting equipment has not been provided in the generator room.</p>

২. পর্যবেক্ষণ

পরিদর্শন পৰ্যবেক্ষণ	<p>□ The generator room smaller than the required size □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cover on the cable trench</p>
ক্যাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	<p>□ Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Generator room □ Install generator on the ground floor □ Install appropriate detectors.</p>
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	<p>On 29.09.2020: > factory hasn't provided fire rated enclosure or door for the generator room. > The generator is installed on the ground floor. > Appropriate detectors have not been installed yet. On 11.01.2021: > factory hasn't provided fire rated enclosure or door for the generator room. > The generator is installed on the ground floor. > Appropriate detectors have not been installed yet. On 13.09.2021: > factory hasn't provided fire rated enclosure or door for the generator room. > The generator is installed on the ground floor. > Appropriate detectors have not been installed yet.</p>

৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> □ The generator room smaller than the required size □ The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cover on the cable trench
ক্যাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> □ Remove Combustible materials from generator room. □ Ensure accessibility and ventilation to generator □ Ensure double earthing of generator frame □ Provide cover on the cable trench
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: > Combustible materials were present in the generator room. > There's not enough clearance to access the generator. Also enough ventilation has not been ensured. > Double earthing of generator room has not been ensured. > No cover was found on the cable trench. On 11.01.2021: > Combustible materials were present in the generator room. > There's not enough clearance to access the generator. Also enough ventilation has not been ensured. > Double earthing of generator room has not been ensured. > No cover was found on the cable trench. On 13.09.2021: > Combustible materials were present in the generator room. > There's not enough clearance to access the generator. Also enough ventilation has not been ensured. > Double earthing of generator room has not been ensured. > No cover was found on the cable trench.</p>

৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<ul style="list-style-type: none"> □ Panel door damaged/not present □ No instruction for first aid to electrical shock □ Access obstructed/barred □ Cable ends not properly soldered or crimped □ Visible burn marks □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board □ MDB/SDB/SB or MCB installed on the wooden board
ক্যাপ আইটেম ক্যাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	<ul style="list-style-type: none"> □ Repair broken/loose MCCB/MCB box. □ Provide duplicate earth leads. □ Provide earthing to body & door. □ Provide earth bar/neutral bar □ Identify cause of burning inside distribution box and take remedial measures □ Provide clear identification mark on distribution board. □ Install MDB/SDB/SB or MCB on metal board.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: > broken/loose MCCB boxes have not been repaired. > duplicate earth leads have not been provided. > No earthing was found in panel body and door. > There's no earth bar/neutral bar from 2nd floor to 5th floor. > No clear identification was found on distributin board.</p> <p>On 11.01.2021: > broken/loose MCCB boxes have not been repaired. > duplicate earth leads have not been provided. > No earthing was found in panel body and door. > There's no earth bar/neutral bar from 2nd floor to 5th floor. > No clear identification was found on distributin board.</p> <p>On 13.09.2021: > broken/loose MCCB boxes have not been repaired. > duplicate earth leads have not been provided. > No earthing was found in panel body and door. > There's no earth bar/neutral bar from 2nd floor to 5th floor. > No clear identification was found on distributin board.</p>

৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Electric cables do not pass through electrical service shaft or insulated conduits <input type="checkbox"/> Connections without lug <input type="checkbox"/> Undressed messy wiring/cables <input type="checkbox"/> Cable ends not properly soldered or crimped
ক্যাপ আইটেম ক্যাটাগরি	

৫.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide electrical service shaft or insulated conduits <input type="checkbox"/> Ensure secured connections with lug <input type="checkbox"/> Replace undressed messy wiring/cables <input type="checkbox"/> Properly solder cable ends
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	<p>On 29.09.2020: > electrical service shaft or insulated conduits are not provided. > secured connection with lugs is not ensured. > undressed messy cables have not been replaced. > Cable ends are not properly soldered. On 11.01.2021: > electrical service shaft or insulated conduits are not provided. > secured connection with lugs is not ensured. > undressed messy cables have not been replaced. > Cable ends are not properly soldered. On 13.09.2021: > electrical service shaft or insulated conduits are not provided. > secured connection with lugs is not ensured. > undressed messy cables have not been replaced. > Cable ends are not properly soldered.</p>

৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Lightning protection system not available
কাপ আইটেম ক্যাটাগরি	

৬.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০১-০১-১৯৭০
অগ্রগতির অবস্থা	চলমান
মন্তব্য	On 11.01.2021: LPS design submitted to DIFE/RCC, but did not found any copy on site. On 13.09.2021: LPS design submitted to DIFE/RCC, but did not found any copy on site.