



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার  
শ্রম ও কর্মসংস্থান মন্ত্রণালয়  
কলকারখালা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখালার নাম	ক্যাশল কল্পাজিট প্রডাক্টস লিঃ
ঠিকানা	SATABDI BHABAN, 2ND & 3RD FLOOR, 19, MAIN ROAD, MIRPUR-10, DHAKA
কারখালার কোড	DHK204
কালার কোড	

মূল্যায়নের ধরণ: <a href="#">বৈদ্যুতিক মূল্যায়ন</a>	পর্যবেক্ষণের তারিখ: <a href="#">—</a>
--	---------------------------------------

১. পর্যবেক্ষণ	
পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. No detector in generator room. Combustible materials inside generator room. One point frame earthing of generator instead of two. No over current or earth fault protection provided. No cable trench
ক্যাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম	
কার্যক্রম	Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room.
সুপারিশের তথ্যসূত্র	
কারখালার কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অধাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০৬-০৯-২০১৬
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবানি
মন্তব্য	10-02-2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. Combustible materials inside generator room. One point frame earthing of generator instead of two. No over current or earth fault protection provided. No cable trench . On 24-05-2021(CVV) , 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. 2. Combustible materials inside generator room. 3. One point frame earthing of generator instead of two. 4. No over current or earth fault protection provided. 5. No cable trench . 6. No appropriate detectors installed for generator room.

২. পর্যবেক্ষণ
---------------

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door No detector in generator room Combustible materials inside generator room One point frame earthing of generator instead of two No over current or earth fault protection provided No cable trench
ক্যাপ আইটেম ক্যাটাগরি	

#### ২.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide over current and earth fault protection <input type="checkbox"/> Provide cable trench with cover
মুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	২৬-০৯-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবলি
মন্তব্য	10-02-2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. Combustible materials inside generator room. One point frame earthing of generator instead of two. No over current or earth fault protection, provided, No cable trench . On 24-05-2021(CVV) , 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. 2. Combustible materials inside generator room. 3. One point frame earthing of generator instead of two. 4. No over current or earth fault protection provided. 5. No cable trench . 6. No appropriate detectors installed for generator room.

#### ৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ Combustible materials inside generator room □ One point frame earthing of generator instead of two □ No over current or earth fault protection provided □ No cable trench
ক্যাপ আইটেম ক্যাটাগরি	

### ৩.১. কার্যক্রম

কার্যক্রম	□ Remove Combustible materials from generator room. □ Ensure double earthing of generator frame
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অধ্যাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	০৮-০৮-২০১৬
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবাণি
মন্তব্য	10-02-2021 on visit day The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. Combustible materials inside generator room. One point frame earthing of generator instead of two. No over current or earth fault protection, provided, No cable trench . On 24-05-2021 (CVV) , 1. The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door. 2. Combustible materials inside generator room. 3. One point frame earthing of generator instead of two. 4. No over current or earth fault protection provided. 5. No cable trench . 6. No appropriate detectors installed for generator room.

### ৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ Access to substation not easy □ Ventilation and illumination of substation is poor □ Separating wall not extended up to the ceiling □ No clear identification mark on distribution panel □ No instruction for first aid to electrical shock and artificial respiration □ Non-conductor mat not provided □ Electric cables do not pass through insulated conduits □ Connection without lug
কাপ আইটেম ক্যাটাগরি	

#### ৪.১. কার্যক্রম

কার্যক্রম	□ Provide easy access to the substation □ Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Substation room. □ Provide clear identification mark on distribution panel. □ Ensure secured connections with lug
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অধার্থিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০৬-০৯-২০১৬
সংশ্লিষ্ট সময়সীমা	০৯-০৯-১৯৭০
অংগতির অবস্থা	শুরু হয়নি
মন্তব্য	10-02-2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration. Non-conductor mat not provided. Electric cables do not pass through insulated conduits. Connection without lug. On 24-05-2021 (CVV), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible. 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration. 6. Non-conductor mat not provided. 7. Electric cables do not pass through insulated conduits. 8. Connection without lug. 9. Multi looping of wiring observed at circuit breakers within distribution boards. 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device

#### ৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Access to substation not easy □ Ventilation and illumination of substation is poor □ Separating wall not extended up to the ceiling □ No clear identification mark on distribution panel □ No instruction for first aid to electrical shock and artificial respiration □ Non-conductor mat not provided □ Electric cables do not pass through insulated conduits □ Connection without lug
কাপ আইটেম ক্যাটাগরি	

#### ৫.১. কার্যক্রম

কার্যক্রম	Provide fire rated enclosure from floor to ceiling and an approved fire rated selfclosing swing door for the Substation room. □ Place substation in ground floor □ Install appropriate detectors
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	৬ গাস
চূড়ান্ত সময়সীমা	২৬-০৯-২০১৭
সংশ্লাধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	10-02-2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration. Non-conductor mat not provided. Electric cables do not pass through insulated conduits. Connection without lug. On 24-05-2021 ( CVV ), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible. 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration. 6. Non-conductor mat not provided. 7. Electric cables do not pass through insulated conduits. 8. Connection without lug. 9. Multi looping of wiring observed at circuit breakers within distribution boards. 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device

#### ৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Access to substation not easy □ Ventilation and illumination of substation is poor □ Separating wall not extended up to the ceiling □ No clear identification mark on distribution panel □ No instruction for first aid to electrical shock and artificial respiration □ Non-conductor mat not provided □ Electric cables do not pass through insulated conduits □ Connection without lug
কাপ আইটেম ক্যাটাগরি	

#### ৬.১. কার্যক্রম

কার্যক্রম	Remove combustible materials from substation. □ Ensure accessibility and ventilation to substation □ Provide instructions for first aid and artificial respiration from exposure to electrical shock. □ Provide cover on the cable trench and rubber mat in front of the panel □ Ensure well-dressed cabling with lugs
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অধার্থিকার	প্রযোজ্য নয়
চূড়ান্ত সময়সীমা	০৮-০৮-২০১৬
সংশ্লিষ্ট সময়সীমা	০৯-০৯-১৯৭০
অংগতির অবস্থা	শুরু হয়নি
মন্তব্য	10-02-2021 on visit day Ventilation and illumination of substation is poor. Separating wall not extended up to the ceiling. No clear identification mark on distribution panel. No instruction for first aid to electrical shock and artificial respiration. Non-conductor mat not provided. Electric cables do not pass through insulated conduits. Connection without lug. On 24-05-2021 (CVV), 1. Ventilation and illumination of substation is poor. 2. Substation room were not found easily accessible. 3. Separating wall not extended up to the ceiling. 4. No clear identification mark on distribution panel. 5. No instruction for first aid to electrical shock and artificial respiration. 6. Non-conductor mat not provided. 7. Electric cables do not pass through insulated conduits. 8. Connection without lug. 9. Multi looping of wiring observed at circuit breakers within distribution boards. 10. Circuits are drawn for loads without the incorporation of an overcurrent protection device

#### ৭. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	No instruction for first aid to electrical shock    Cable ends not properly soldered or crimped    Connection without lug    Messy wire inside    Body & door not earthed    No clear identification mark on distribution board
ক্যাপ আইটেম ক্যাটাগরি	

#### ৭.১. কার্যক্রম

কার্যক্রম	Provide earthing to body & door.    Provide clear identification mark on distribution board.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অঞ্চাকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০৬-০৯-২০১৬
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অঞ্চাকার অবস্থা	শুরু হবলি
মন্তব্য	10-02-2021 on visit day No instruction for first aid to electrical shock Cable ends not properly soldered or crimped.Connection without lug. Messy wire inside.Body & door not earthed.No clear entification mark on distribution board. On 24-05-2021(CVV), 1.No instruction for first aid to electrical shock 2.Cable ends not properly soldered or crimped. 3.Cables were not connected with proper sized lugs . 4.Cables wirings were not found well dressed in distribution boards 5.No clear identification mark on distribution board. 6.No grounding for All distribution boards

#### ৮. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	□ No instruction for first aid to electrical shock □ Cable ends not properly soldered or crimped □ Connection without lug □ Messy wire inside □ Body & door not earthed □ No clear identification mark on distribution board
ক্যাপ আইটেম ক্যাটাগরি	

#### ৮.১. কার্যক্রম

কার্যক্রম	□ Provide instructions for first aid from exposure to electrical shock □ Ensure well-dressed cabling with lugs
মুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অংগীকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	০৮-০৮-২০১৬
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অংগতির অবস্থা	শুরু হবলি
মন্তব্য	10-02-2021 on visit day No instruction for first aid to electrical shock Cable ends not properly soldered or crimped.Connection without lug. Messy wire inside.Body & door not earthed.No clear entification mark on distribution board. On 24-05-2021(CVV) , 1.No instruction for first aid to electrical shock 2.Cable ends not properly soldered or crimped. 3.Cables were not connected with proper sized lugs . 4.Cables wirings were not found well dressed in distribution boards 5.No clear identification mark on distribution board. 6.No grounding for All distribution boards

#### ৯. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	<input type="checkbox"/> Electric cables do not pass through insulated conduits <input type="checkbox"/> Connections without lug <input type="checkbox"/> Messy wiring <input type="checkbox"/> Cable ends not properly soldered or crimped
কাপ আইটেম ক্যাটাগরি	

#### ৯.১. কার্যক্রম

কার্যক্রম	<input type="checkbox"/> Provide service ducts or insulated conduits <input type="checkbox"/> Ensure secured connections with lug <input type="checkbox"/> Replace messy wiring <input type="checkbox"/> Properly solder cable end
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	০৬-০৯-২০১৬
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	10-02-2021 on visit day Electric cables do not pass through insulated conduits Connections without lug Messy wiring.Cable ends not properly soldered or crimped. On 24-05-2021(CVV) , 1.Electric cables do not pass through insulated conduits. 2.Cables were not connected with proper sized lugs. 3.Cables wirings were not found well dressed in distribution boards. 4.Distribution Board not concealed. 5.Electrical cables are not sized according to capacity of circuit breakers

#### ১০. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Lightning protection system not available
কাপ আইটেম ক্যাটাগরি	

#### ১০.১. কার্যক্রম

কার্যক্রম	Provide appropriate Lightning protection system.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	WE have not taken any action yet but it will be completed within timeline
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	২৬-০৯-২০১৭
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হয়নি
মন্তব্য	10-02-2021 on visit day Lightning protection system not obtainable. On 24-05-2021(CVV) , Lightning protection system not obtainable.