

গণপ্রজাতন্ত্রী বাংলাদেশ সরকার শ্রম ও কর্মসংস্থান মন্ত্রণালয় কলকারখানা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

"সুস্থ শ্রমিক, শোতন কর্মপরিবেশ; াড়ে জুলবে স্মার্ট বাংলাদেশ"

ক্যাপ পর্ববেষ্ফণের তথ্য

কারখানার নাম	৭৩ কালার কেম লিমিটেড	
ঠিকানা	House# 791, 275, (Narsingdi Sadar, Narsingdi, Dhaka)	
কারখানার কোড	CNRD004	
কালার কোড		

୩: ବାଧା(ଧାର୍ମ ଧୂର୍ମ) ମ୍ୟୁର	প্ৰথবেষ্ক(ণৰ জাৰ্য:			
১. পর্যবেষ্ণণ				
Ill Factory Building has no approved master plan from the carchitectural and Structural drawings were not available for any of the build was not available. Any Material Test Report was not ot available for any of the factory building. According aboratory Building, Sub-station and Canteen Building Green. But the building has not proper engineering apport. There is no cross bracing in roof or wall of Standard engineer Factory should conduct Detail Englishing.	able for any of the building. As- ding. Sub soil investigation report available. Also Design Report was ng to FoS, Color code of Office and ing & Raw Materials Store Building g documents and material test teel Frame Structures, so is Under guidance from a qualified			
১.১. কাৰ্বক্ৰম				
Develop a full set of as-built Architectural and Str Plan, Section, Elevation details, all structural mer all the building. Factory should also conduct Deta for all Building. All prepared as-built documents of requirements of BNBC 2020.	mbers and foundations details for il Engineering Assessment (DEA)			
1				
1				
	ll Factory Building has no approved master plan from the creditectural and Structural drawings were not available for any of the building not available. Any Material Test Report was not ot available for any of the factory building. According aboratory Building, Sub-station and Canteen Building Green. But the building has not proper engineering apport. There is no cross bracing in roof or wall of Standancy in lateral load path is not apparent. Thus tructural engineer Factory should conduct Detail Englishing. Develop a full set of as-built Architectural and Standancy in lateral load path is not apparent. Thus tructural engineer Factory should conduct Detail Englishing. Develop a full set of as-built Architectural and Standancy in lateral properties and standancy in lateral load path is not apparent. The cructural engineer Factory should conduct Detail Englishing. All Develop a full set of as-built Architectural and Standancy in lateral properties and standancy in lateral load path is not apparent. The cructural engineer Factory should also conduct Detail Englishing in lateral load path is not apparent. The properties in lateral load path is not apparent. The properties in lateral load path is not apparent. The properties is not apparent. The properties is not apparent in lateral load path is not apparent. The properties is not apparent. The properties is not apparent in lateral load path is not apparent. The properties is not apparent in lateral load path is not apparent. The properties is not apparent in lateral load path is not apparen			

পৰিদৰ্শন Uncontrolled loading has been observed at 1st floor of Raw Materials Store Building. প্ৰ্যবেষ্ণন There is no marking at storage area indicating maximum allowable loading limit.
ক্যাপ
অাইটেম
ক্যাটাগরি
ורורוסולץ
২.১. কাৰ্যক্ৰম
Develop a program to ensure that all live loads for which a floor has been designed
কাৰ্শজন for will not be exceeded. The designated Load Manager shall oversee this program
and ensure it is enforced.
সুপারিশের
ভিখ্যসূত্ৰ
কারখানার
কাৰ্যক্ৰম
অগ্রাধিকার প্রয়োগ্য নয়
চুডান্ত
प्रेमेय्रप्रीमा
সংশোধিত
অগ্রগতির
অবস্থা
মন্ভব্য
৩. পর্যবেষ্ট্রণ

পরিদর্শন Uncontrolled loading has been observed at 1st floor of Raw Materials Store Building. পর্শবেষ্ফণ There is no marking at storage area indicating maximum allowable loading limit. ক্যাপ আইটেম ক্যাটাগরি ৩.১. কাৰ্যক্ৰম Have a qualified structural engineer confirm the capacity to support the load is কাৰ্যক্ৰম available. Load Plans should also be developed. সুপারিশের ভখ্যসূত্র কারখানার কাৰ্শক্ৰম **অগ্রাধিকার** প্রযোগ্য নয় চুডান্ড সময়সীমা সংশোধিত সময়সীমা <u>অগ্রগতির</u> অবস্থা মন্তব্য

৪. পর্যবেষ্ণণ

পরিদর্শন পর্শবেষ্ফণ		
ক্যাপ আইটেম ক্যাটাগরি		
৪.১. কার্যক্রম		
Parapet wall of Roof Top should have built up to 42ll as directed by proper guidance.		
সুপারিশের তথ্যসূত্র		
কার্থানার কার্যক্রম		
অ্থাধিকার প্রযোজ্য নর		
ু চুড়ান্ত সম্ব্যসীমা		
সংশোধিত _ সমরসীমা		
অগ্রগতির অবস্থা		
মন্তব্য		
<i>৬</i> . পর্যবেষ্ষণ		
পরিদর্শন পরিদর্শন পর্যবেষ্ণণ Production Shed, Raw Materials Store Building & Production Shed and Raw Materials Store Building.		
ক্যাপ আইটেম ক্যাটাগরি		

Sections of plaster finish to brick wall to be removed to investigate if dampness penetrates into the building wall. Investigation needed to determine the source of

the damp and way to prevent it re-occurring. Carry out any remedial actions as directed by the Building Engineer. All Steel Member should be painted properly.

৫.১. কাৰ্যক্ৰম

কাৰ্যক্ৰম

সুপারিশের তখ্যসূত্র কারখানার কার্যক্রম

চুডান্ত সমরসীমা সংশোধিত সমরসীমা অগ্রগতির অবস্থা মন্তব্য

অগ্রাধিকার প্রযোজ্য নয়