



গণপ্রজাতন্ত্রী বাংলাদেশ সরকার
শ্রম ও কর্মসংস্থান মন্ত্রণালয়
কলকারখালা ও প্রতিষ্ঠান পরিদর্শন অধিদপ্তর

মুরগ্কা নিবন্ধন নিশ্চিত করণ

ক্যাপ পর্যবেক্ষণের তথ্য

কারখালার নাম	গেমার্স এ্যাপোলো ক্যাপশন্স লিঃ
ঠিকানা	PLOT # I-5/2, ROAD # 7, SEC # 7, MIRPUR, DHAKA
কারখালার কোড	DHK060
কালার কোড	

মূল্যায়নের ধরণ: বৈদ্যুতিক মূল্যায়ন	পর্যবেক্ষণের তারিখ: ০২-০৮-২০২৩
১. পর্যবেক্ষণ	

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ No over current or earth fault protection provided □ No cover on the cable trench
কাপ আইটেম ক্যাটাগরি	

১.১. কার্যক্রম

কার্যক্রম	Produce design drawings to demonstrate the incorporation of fire rated enclosure from floor to ceiling and an approved fire rated self-closing swing door for the Generator room. □ Provide firefighting equipment as required by the Guidelines. □ Provide over current and earth fault protection
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We have completed all issue except combustible material inside the generator room. We will complete all this issue within the given timeline.
অধার্থিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৭-০৮-২০১৭
সংশ্লিষ্ট সময়সীমা	১৫-০৮-২০২২
অংগতির অবস্থা	সংশ্লিষ্ট
মন্তব্য	29-08-2021 (CVV) : 1. Generator is located on ground floor building. 2. They have been provided fire separation. 3. They didn't provide first aid box and artificial respiration. 4. Generator is earthed at two points. 5. Illumination is sufficient in generator room. 6. Dust has not been found in generator room. 7. Factory has submitted detection design to DIFE and waiting for approval. 8. Cover on the cable trench. 14-08-2022: 1. They didn't provide first aid box and artificial respiration. 2. Dust has not been found in generator room. 02-04-2023: 1. Factory has been provided proper fire separation for generator room. 2. Fire detector has been provided for generator room. 3. No combustible materials were found inside generator room. 4. Proper cover on the cable trench was found.

সংযুক্তসমূহ (৮)



২. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ No over current or earth fault protection provided □ No cover on the cable trench
কাপ আইটেম ক্যাটাগরি	

২.১. কার্যক্রম

কার্যক্রম	Provide fire rated enclosure from floor to P27.2 ceiling and an approved fire rated selfclosing swing door for the Generator room □ Install appropriate detectors.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have completed this issue.
অধ্যাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	-
সংশোধিত সময়সীমা	০৪-০৯-২০২৩
অঞ্চলিক অবস্থা	সংশোধিত
মন্তব্য	29-08-2021 (CVV) : 1. Generator is located on ground floor building. 2. They has been provide fire separation. 3. They didn't provide first aid box and artificial respiration. 4. Generator is earthed at two point. 5. Illumination is sufficient in generator room. 6. Dust has not been found in generator room. 7. Factory has submitted detection design to DIFE and waiting for approval. 8. Cover on the cable trench. 14-08-2022 : 1. They didn't provide first aid box and artificial respiration. 2. Dust has not been found in generator room. 02-04-2023: 1. Factory has been provided proper fire separation for generator room. 2. Fire detector has been provided for generator room. 3. No combustible materials was found inside generator room. 4. Proper cover on the cable trench was found.
সংযুক্তিমূল্য (৮)	
<input type="checkbox"/>	

৩. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	The generator room is not properly segregated from the rest of the occupancy due to presence of non Fire-rated Door □ No detector in generator room □ No firefighting equipment is present in the generator room □ Combustible materials inside generator room □ No over current or earth fault protection provided □ No cover on the cable trench
কাপ আইটেম ক্যাটাগরি	

৩.১. কার্যক্রম

কার্যক্রম	Remove Combustible materials from generator room. □ Provide cover on the cable trench
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have provided cable tray at generator room. We will complete all this issue within the given timeline.
অংশাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১৭-০৮-২০২১
সংশোধিত সময়সীমা	০৯-০৯-১৯৭০
অংগুলিত্ব অবস্থা	সংশোধিত
মন্তব্য	29-08-2021 (CVV) : 1. Generator is located on ground floor building. 2. They have been provided fire separation. 3. They didn't provide first aid box and artificial respiration. 4. Generator is earthed at two points. 5. Illumination is sufficient in generator room. 6. Dust has not been found in generator room. 7. Factory has submitted detection design to DIFE and waiting for approval. 8. Cover on the cable trench. 14-08-2022 : 1. They didn't provide first aid box and artificial respiration. 2. Dust has not been found in generator room. 02-04-2023: 1. Factory has been provided proper fire separation for generator room. 2. Fire detector has been provided for generator room. 3. No combustible materials were found inside generator room. 4. Proper cover on the cable trench was found.

মংযুক্তিমন্তব্য (৮)



৪. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	No instruction for first aid to electrical shock □ Access obstructed/barred □ Visible burn marks □ Body & door not earthed □ No clear identification mark on distribution board □ Live parts of machine or equipment exposed □ MDB was not accessible
ক্যাপ আইটেম ক্যাটাগরি	

৪.১. কার্যক্রম

কার্যক্রম	Provide earthing to body & door. □ Identify cause of burning inside distribution box and take remedial measures □ Provide clear identification mark on distribution board.
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but agreed to complete the issue within the given timeline.
অধ্যাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৭-০৮-২০১৭
সংশ্লাধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	শুরু হবাণি
মন্তব্য	29-08-2021 (CVV) : All the required design drawings are submitted to DIFE with the help of an enlisted farm named EQMS. 1. No identification marking in distribution board. 2. No instruction board for first aid to electrical shock and artificial respiration. 3. Insulation of rubber mats are not provided in front of Distribution boards 4. Multiple looping are found in DB/MDB. 5. Connections with lugs are present in DB. 6. Undressed messy wires are still present in DB. 7. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 14-08-2022 : 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Body & door not earthed. 4. No clear identification mark on distribution board. 5. Live parts of machine or equipment exposed. 6. MDB was not accessible. 02-04-2023: 1. No instruction for first aid to electrical shock was found. 2. Access obstructed/barred to panel board was found. 3. Panel board body & door were not earthed. 4. No clear identification mark on distribution board was found. 5. Live parts of machine or equipment exposed. 6. MDB was not accessible.
সংযুক্তিমূহু (৮)	<input checked="" type="checkbox"/>

৫. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	No instruction for first aid to electrical shock □ Access obstructed/barred □ Visible burn marks □ Body & door not earthed □ No clear identification mark on distribution board □ Live parts of machine or equipment exposed □ MDB was not accessible
ক্যাপ আইটেম ক্যাটাগরি	

৫.১. কার্যক্রম

কার্যক্রম	Provide instructions for first aid from exposure to electrical shock □ Remove obstruction to ensure access to MDB/MCB Box □ Encase live machine and/or equipment parts
সুপারিশের তথ্যসূত্র	
কার্যক্রম কার্যক্রম	We have not taken any action but agreed to complete the issue within the given timeline.
অধ্যাধিকার	প্রযোজ্য নথি
চূড়ান্ত সময়সীমা	১৭-০৮-২০১৭
সংশ্লাধিত সময়সীমা	০১-০৯-১৯৭০
অগ্রগতির অবস্থা	শুরু হবাণি
মন্তব্য	29-08-2021 (CVV) : All the required design drawings are submitted to DIFE with the help of an enlisted farm named EQMS. 1. No identification marking in distribution board. 2. No instruction board for first aid to electrical shock and artificial respiration. 3. Insulation of rubber mats are not provided in front of Distribution boards 4. Multiple looping are found in DB/MDB. 5. Connections with lugs are present in DB. 6. Undressed messy wires are still present in DB. 7. Body & Door of DB is not properly earthed. Total system earthing is not properly done as per NTPA. Need to submit earthing system design for review. 14-08-2022 : 1. No instruction for first aid to electrical shock. 2. Access obstructed/barred. 3. Body & door not earthed. 4. No clear identification mark on distribution board. 5. Live parts of machine or equipment exposed. 6. MDB was not accessible. 02-04-2023: 1. No instruction for first aid to electrical shock was found. 2. Access obstructed/barred to panel board was found. 3. Panel board body & door were not earthed. 4. No clear identification mark on distribution board was found. 5. Live parts of machine or equipment exposed. 6. MDB was not accessible.
সংযুক্তিমূহু (৮)	<input checked="" type="checkbox"/>

৬. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Electric cables do not pass through insulated conduits
কাপ আইটেম ক্যাটাগরি	

৬.১. কার্যক্রম

কার্যক্রম	Provide insulated conduits
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We have not taken any action but agreed to complete the issue within the given timeline.
অগ্রাধিকার	৬ সপ্তাহ
চূড়ান্ত সময়সীমা	১৭-০৮-২০১৭
সংশ্লাধিত সময়সীমা	১৫-০৮-২০২২
অগ্রগতির অবস্থা	ক্ষেত্র হ্যালি
মন্তব্য	29-08-2021 (CVV): Few electrical cables run through conduits rest of the cables where found unprotected. 14-08-2022: Few electrical cables run through conduits rest of the cables where found unprotected. 02-04-2023: Electric cables were not pass through insulated conduits.

সংযুক্তিমূল্য (২)



৭. পর্যবেক্ষণ

পরিদর্শন পর্যবেক্ষণ	Lightning protection system not available □ No earthing/lighting pit is identified
কাপ আইটেম ক্যাটাগরি	

৭.১. কার্যক্রম

কার্যক্রম	Provide appropriate Lightning protection system
সুপারিশের তথ্যসূত্র	
কারখানার কার্যক্রম	We have not taken any action but agreed to complete the issue within the given timeline.
অগ্রাধিকার	৬ মাস
চূড়ান্ত সময়সীমা	১৭-১৯-২০১৭
সংশ্লাধিত সময়সীমা	০৪-০৯-২০২৩
অগ্রগতির অবস্থা	চলচাল
মন্তব্য	29-08-2021 (CVV): Factory engaged consulting farm to prepare LPS drawing which has not been completed yet. 16-08-2022: Factory engaged consulting farm to prepare LPS drawing which has not been completed yet. 02-04-2023: LPS has been installed on top of the building but no approved drawing has been found.

সংযুক্তিমূল্য (২)



